# **High-Precision Process Calibrator**



# CED 7000

High-Precision Process Calibrator CED7000



# CED 7000 Operatoring instructions

1. Introduction	5
1.1 Customer Service	5
1.2 Standard Equipment	
1.3 Options and Accessories	
1.4 Unpacking	
1.5 Safety Information	
2. Calibrator Description	8
2.1 Front Panel Overview	
2.2 Primary Input/Output Terminals	
2.3 Primary Input/Output Display and Controls	11
2.4 Isolated Input Display, Controls, and Terminals	
2.5 Rear Panel	13
2.6 Display Layouts	14
2.7 Error Messages	16
3. Getting Started	
4. Primary Inputs and Outputs	
4.1 DC Voltage Output	
4.2 DC Current Output	
4.3 Resistance Temperature Detector (RTD) and Ohms Measure	19
4.4 Resistance Temperature Detector (RTD) and Ohms Source	
4.5 Resistance Temperature Detector (RTD) with Custom Coefficients	
4.6 Standard Platinum Resistance Thermometer (SPRT) Coefficients	
4.7 Thermocouple (T/C) Measure	
4.8 Thermocouple (TC) Source	
4.9 Pressure Measure	
5. Isolated Inputs	
5.1 Voltage Input	
5.2 Current Input	
5.3 Pressure Input	27
6. Output Setpoints	28
7. Application Notes	
7.1 P/I Transmitter	
7.2 I/P Transmitter	
7.3 V/I Transmitter	
7.4 RTD Test	31
7.5 RTD Transmitter	
7.6 Thermocouple Test	
7.7 Thermocouple Transmitter	
7.8 RTD Indicator	
7.9 Precision Current Trip	
7.10 I/I Isolator/Transmitter	
7.11 Precision Temperature Measurement with IBP-2 Probe	
8. LCD and Remote Interface Setup Procedures	

9. Remote Interface	
9.1 Introduction	
9.2 Setting up the RS-232 Port for Remote Control	
9.2.1 Using the CED 7000 on Computers with USB Ports	
9.3 Setting up the IEEE-488 Port for Remote Control	37
9.4 Changing Between Local and Remote Operation	
9.5 IEEE-488 Interface Overview	
9.6 Using Commands	
9.7 Checking CED 7000 Status	
10. Remote Commands	47
10.1 Introduction	
10.2 Command Summary by Function	
10.3 Error Code Listing	
10.4 Remote Command Listing	
11. Maintenance	67
11.1 Cleaning the Calibrator	
11.2 Replacing a Line Fuse	
11.3 Changing the Line Voltage	
12. Specifications	
12.1 General Specifications	
12.2 DC Voltage Specifications, Output	
12.3 DC Voltage Specifications, Isolated Input	
12.4 DC Current Specifications, Output	
12.5 DC Current Specifications, Isolated Input	
12.6 Resistance Specifications, Output	70
12.7 Resistance Specifications, Input	70
12.8 Thermocouple Specification, Output and Input	
12.9 RTD and Thermistor Specification, Output	72
12.10 RTD and Thermistor Specification, Input	
12.11 Pressure Measurement Specifications	75
13. Warranty	75

# 1. Introduction

The WIKA CED 7000 calibrator is an accurate full-featured temperature, pressure and DC calibrator intended for R & D, manufacturing and calibration lab applications. The unit's simple design and ease of operation allow users to quickly familiarize themselves with its operations and features. Time saving functions like the ability to save, recall and automatically cycle through setpoints for each output range, the ability to enter user definable RTD curves, and a complete remote interface are several key features offered by the CED 7000.

# **1.1 Customer Service**

Corporate Office: www.wika.com E-mail: Vertrieb@wika.de Tel: (+49) 09372 ·132 – 0 Fax: (+49) 09372 ·132 – 406 WIKA Alexander Wiegand SE & Co. KG Alexander-Wiegand-Straße 63911 Klingenberg Germany

# **1.2 Standard Equipment**

- Power cord
- Thermocouple shorting jumper

# **1.3 Options and Accessories**

- IBP-2 PT100 High Accuracy Probe
- 80029 JKTE Thermocouple Kit
- 80036 RSNB Thermocouple Kit
- PTL-1 Low EMF Beryllium Copper Test Leads
- 80313 USB Serial Converter
- 80157 Null Modem Cable
- Connection Cable Mensor 6100

# 1.4 Unpacking

Upon receipt of the shipment, inspect the container and equipment for any signs of damage. Take particular note of any evidence of rough handling in transit. Immediately report any damage to the shipping agent.

**NOTE:** The carrier will not honor any claims unless all shipping material is saved for their examination.

After examining and removing the contents, save the packing material and carton in the event that reshipment is necessary.

Remove the Packing List and verify that all of the listed equipment has been received. If there are any questions about the shipment, please call WIKA.

Check to see if your basic calibrator package is complete. It should include:

- CED 7000 Calibrator
- Instruction Manual
- AC Line Cord
- Thermocouple Shorting Jumper
- Certificate

# 1.5 Safety Information

#### Symbols Used

The following table lists the International Electrical Symbols. Some or all of these symbols may be used on the instrument or in this manual.

Symbol	Description
$\sim$	AC (Alternating Current)
$\sim$	AC-DC
÷	Battery
€	CE Complies with European Union Directives
	DC
	Double Insulated
Â	Electric Shock
₽	Fuse
	PE Ground
<u></u>	Hot Surface (Burn Hazard)
$\wedge$	Read the User's Manual (Important Information)
0	Off
	On

The following definitions apply to the terms "Warning" and "Caution".

• "Warning" identifies conditions and actions that may pose hazards to the user.

• " Caution" identifies conditions and actions that may damage the instrument being used.

Use the calibrator only as specified in this manual, otherwise personal injury and/or damage to the calibrator may occur.

Warning

#### To avoid possible electric shock or personal injury:

• A condition for trouble-free and safe operation of this system is proper transport, proper storage, installation, assembly and proper use as well as careful operation and maintenance. Any other operation than the one described in the following instructions is improper and must therefore be excluded.

• The calibrator always has to be handled with the care required for an electronic precision instrument (protect from humidity, impacts, strong magnetic fields, static electricity and extreme temperatures, do not insert any objects into the instrument and its openings).

• The system is fed via the mains cable with a voltage which is dangerous for human beings. Even after disconnecting the instrument from the mains dangerous voltages can temporarily occur due to capacitance in the circuitry.

• If the display is damaged, splinters may present a danger.

• If faults cannot be repaired with the use of the manual, the system must be turned off immediately and disconnected from mains power.

• Do not apply more than the rated voltage between the terminals, or between any terminal and chassis ground. See specifications for supported ranges.

· Follow all equipment safety procedures.

• Always use the power cord and connector suitable for the voltage and outlet of the location in which you are working.

• Do not use the calibrator if it is damaged. Before you use the calibrator, inspect the case. Look for cracks or missing plastic. Pay particular attention to the insulation surrounding the connectors.

• Inspect the test leads for damaged insulation or exposed metal. Check test lead continuity. Replace damaged test leads before you use the calibrator.

• Never operate the calibrator with the cover removed or the case open, and never remove the cover or open the case without first disconnecting the power source and all test leads.

· Select the proper terminals, function and range for your measurement.

• Never touch the probe to a voltage source when the test leads are plugged into the current terminals.

• When using the probes, keep your fingers away from the probe contacts. Keep your fingers behind the finger guards on the probes.

• Connect the common test lead before you connect the live test lead. When you disconnect test leads, disconnect the live test lead first.

• Do not use the calibrator if it operates abnormally. Protection may be impaired. When in doubt, have the calibrator serviced.

• Do not operate the calibrator around explosive gas, vapor, or dust.

• When using a pressure module, make sure the process pressure line is shut off and depressurized before you connect it or disconnect it from the pressure module.

• Disconnect test leads before changing to another measure or source function.

• Have the calibrator serviced only by qualified personnel, and use only specified replacement parts.

· Use only the replacement fuse(s) specified in this manual.

• To avoid a violent release of pressure in a pressurized system, shut off the valve and slowly bleed off the pressure before you attach the pressure module to the pressure line.

· Do not use the calibrator in wet environments.

• The calibrator can output lethal voltages. Use it only as described in this manual.

• Verify the calibrator's operation by measuring a known voltage before and after using it. Do not use the calibrator if it operates abnormally. Protection may be impaired. If in doubt, have the calibrator serviced.

• Use caution when working with high voltages. These voltages pose a shock hazard.

• Before measuring current, check the calibrator's fuses and turn OFF power to the circuit before connecting the calibrator to the circuit.



#### To avoid possible damage to the calibrator or to the equipment under test:

• Use the proper terminals, function, and range for your measurement or sourcing application.

• To avoid mechanically damaging the pressure module, never apply more than 10 ft-lb of torque between the pressure module fittings, or between the fittings and the body of the module.


• To avoid damaging the pressure module from overpressure, never apply pressure above the rated maximum printed on the module.

• To avoid damaging the pressure module from corrosion, use it only with specified materials. Refer to the pressure module documentation for material compatibility.

# 2. Calibrator Description

# 2.1 Front Panel Overview

Figure 1 shows the overall layout of the front panel. Each of the three major divisions is described in detail in the following sections.

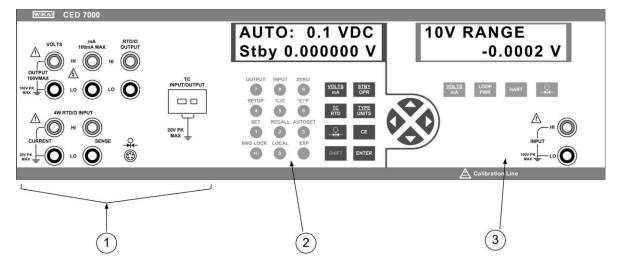

#### Figure 1 - Front Panel

Item	Name	Description
1	Primary input/output terminals	See section 2.2 for details
2	Primary input/output display and controls	See section 2.3 for details
3	Isolated input display, controls, and terminals	See section 2.4 for details

#### 2.2 Primary Input/Output Terminals

Figure 2 describes the primary input/output terminals in detail. The display and controls for these terminals are described in the next section.

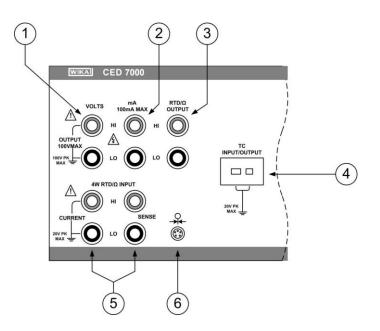


Figure 2 - Primary Input/Output Terminals

ltem	Name	Description
1	VOLTS	DC voltage output terminals. See notes 1 and 2 below.
2	mA	DC current output terminals. See notes 1 and 2 below.
3	RTD/Ω OUTPUT	Two wire RTD and Ohms output terminals. See notes 1 and 2 below.
4	TC INPUT/OUTPUT	Thermocouple input and output terminals. These terminals accept a miniature polarized thermocouple plug with flat in-line blades spaced 7.9 mm (0.312 in.) center to center.
5	4W RTD/Ω INPUT	Four wire RTD and Ohms input terminals. See notes 1 and 3 below.
6	$\rightarrow$	Pressure module input connector.

*Note 1:* These terminal binding posts are made of a special copper alloy to reduce thermal EMF's. They support the use of either discreet wires or standard banana plugs, and the HI/LO pairs are spaced for standard dual banana plugs.

Note 2: Caution. Do not exceed a maximum of 100 volts to chassis ground.

Note 3: Caution. Do not exceed a maximum of 20 volts to chassis ground.

# 2.3 Primary Input/Output Display and Controls

Figure 3 describes the primary input/output display and controls in detail.

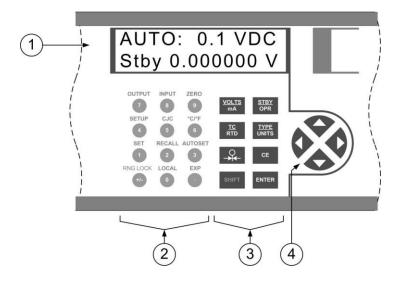



Figure 3 - Primary Input/Output Display and Controls

Item	Name		Description
1	Display		A 2 line, 16 character, display providing all visual user feedback for the primary output and input operations. See section 2.6 for layout details, and section 2.7 for possible error messages.
2	function ke	nd secondary eys	Output value data entry keys. Secondary function selection per the text printed above the numeric key. Press the key followed by the numeric key to select the function.
	OUTPUT	SHIFT 7	Change RTD/Ohms or Thermocouple to output mode.
	INPUT	SHIFT 8	Change RTD/Ohms or Thermocouple to input mode.
	ZERO	SHIFT 9	Zero the input for Pressure, Thermocouple millivolts, or RTD ohms.
	SETUP	SHIFT 4	Adjust the LCD Contrast, LCD Backlight, and Remote Interface Configuration as described in section 8.
	CJC	SHIFT 5	Select internal or external cold junction compensation for Thermocouple temperature measurements. When external compensation is selected, XCJC is displayed at the start of the second line.
	°C/°F	SHIFT 6	Select Centigrade or Fahrenheit units for RTD and Thermocouple temperature measurements.
	SET	SHIFT 1	Set a new value for a preset output setpoint as described in section 6.
	RECALL	SHIFT 2	Recall a preset output setpoint as described in section 6.

	AUTOSET SHIFT 3	Initiate automatic stepping of preset output setpoints as
	RNG LOCK	described in section 6.
	SHIFT +/-	Select Auto-range or Range Lock for voltage output.
	LOCAL SHIFT 0	Press to regain local control of the CED 7000 after the remote command REMOTE has been received; in this case all keys except this one are ignored. When the remote command LOCKOUT has been received, all keys are ignored including this one and the remote command LOCAL must be received to regain local control.
	EXP SHIFT •	Press during entry of a RTD custom curve coefficient to begin entering the exponent.
3	Function keys	
	VOLTS mA	Select DC voltage or current output mode, and toggle between them.
	TC RTD	Select Thermocouple or RTD/Ohms input/output mode, and toggle between them.
		Select Pressure input mode.
	<u>TYPE</u> UNITS	In Thermocouple mode, cycle through the Thermocouple types, including millivolts. In RTD/Ohms mode, cycle through the RTD types, including ohms. In Pressure mode, cycle through the pressure units.
	STBY OPR	For all output modes, except Thermocouple, toggle between Standby and Operate modes. In Standby mode, any change to the output value in the display is not driven to the terminals until the Operate mode is selected. In Operate mode, each change to the output value in the display is driven to the terminals immediately, except for DC voltages greater then 30V when the mode reverts to Standby automatically for safety reasons.
	ENTER	Changes the calibrator output or parameter to the numeric value typed into the keypad.
	CE	Clears a partial keypad entry and reverts the calibrator output or parameter to its last known value.
	SHIFT	Prepares for selection of a secondary function via the numeric keypad according to the text above each key. The display changes to SHIFT ENABLED until a numeric key is pressed. To cancel the selection press
4	Cursor controls	<ul> <li>Press or or oto position the cursor under the digit in an output value that is to be incremented or decremented.</li> <li>Press or to increment the digit in the output value where the cursor is positioned.</li> <li>Press or to decrement the digit in the output value where the cursor is positioned.</li> <li>The or and or keys are also used to adjust LCD Contrast level, LCD Backlight level, and Remote Interface Configuration selections as Described in section 8.</li> </ul>

# 2.4 Isolated Input Display, Controls, and Terminals

Figure 4 describes the isolated input display, controls, and terminals in detail.

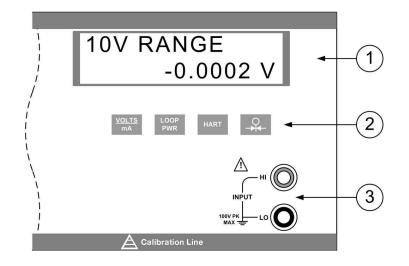




Item	Name	Description
1	Display	A 2 line, 16 character, display providing all visual user feedback for the isolated input operations. See section 2.6 for layout details, and section 2.7 for possible error messages.
2	Function keys	
	VOLTS mA	Select DC voltage and current input mode. Subsequent presses of this key cycle through the ranges: 10V, 100V, and 50mA.
	LOOP PWR	When using 50mA mode to test a 2 wire loop powered transmitter that is disconnected from its wiring, press this key to activate an internal 24V power supply in series with the current measuring circuit. Press the key again to deactivate the 24V supply.
	HART	When using 50mA mode to test a HART configuration device, press this key to activate an internal 250 ohm resistor in series. Press the key again to deactivate the resistor.Note that activating this resistor drops the maximum load driving capability from 1000 ohms at 20mA to 750 ohms at 20mA.
		Select Pressure input mode. Subsequent presses of this key cycle through the pressure units.Pressure input mode uses the pressure module connector on the primary input/output side. Both sides may be selected to pressure mode simultaneously and can be set to display the same pressure measurement in different units if desired.
3	Input Terminals	Common input terminals for DC voltage and current. See notes 1 and 2 below.

*Note 1*: These terminal binding posts are made of a special copper alloy to reduce thermal EMF's. They support the use of either discreet wires or standard banana plugs, and the HI/LO pairs are spaced for standard dual banana plugs.

*Note 2:* Caution. Do not exceed a maximum of 100 volts to chassis ground.

# 2.5 Rear Panel

Figure 5 describes the rear panel layout.

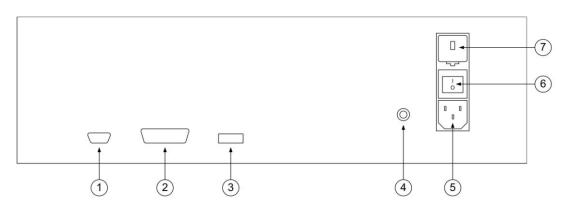


# Figure 5 - Rear Panel

Item	Description
1	RS-232 9 pin connector for remote control of the CED 7000 via any computer's serial interface.
2	GPIB IEEE 488.2 connector for remote control of the CED 7000 via a GPIB bus.
3	Service port for updating the CED 7000 firmware (Factory use only).
4	Chassis ground terminal internally connected to the ground prong of the AC power inlet. Warning To avoid shock hazard, connect the factory supplied 3 conductor power cord to a properly grounded power outlet. Do not use a 2 conductor adapter or extension cord as this will break the protective ground. Use the chassis ground terminal for a protective ground wire if there is any question about the grounding through the 3 conductor power cord.
5	Standard IEC AC power inlet for 120/240 VAC.
6	Main power on/off switch.
7	Power line voltage selector and fuse compartment. See section 11 for instructions on changing the line voltage selector and changing fuses.           Warning         To prevent electrical shock, only remove the line voltage selector and fuse holder when the power cord is removed.

# 2.6 Display Layouts

a) Primary Voltage and Current Display

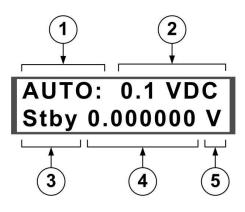

# Figure 6 - Primary Voltage and Current Display Layout

ltem	Description	
1	Operating mode:         AUTO:       Auto-range         LOCK:       Range lock         rem       remote operation         SP#       Automatic stepping of present setpoints	
2	Present range and output mode	
3	Output state:StbyStandby, terminals inactiveOprOperating, terminals are active with output per the displayed value	
4	Output value	
5	Units	

#### b) Primary Thermocouple and RTD Display

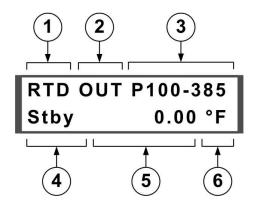


Figure 7 - Primary Thermocouple and RTD Display Layout

ltem	Description
1	Output mode selection: RTD, TC, or rem for remote operation
2	Input or output selection
3	RTD or thermocouple type selection

4	Output state for RTD outputs:         Stby       Standby, terminals inactive         Opr       Operating, terminals are active with output per the displayed value         Blank for RTD inputs       Cold junction selection for thermocouple inputs and outputs:         XCJC       External cold junction compensation; the CED 7000 automatic cold junction compensation is turned off, i.e. 0 mV is always 0°C         Blank       Internal cold junction compensation; the CED 7000 automatically measures the ambient temperature at the thermocouple terminals and compensates the measurement, i.e. 0 mV is ambient temperature
5	Input or output value
6	Units

# c) Primary and Isolated Pressure Display

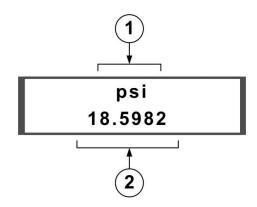


Figure 8 - Primary and Isolated Pressure Display Layout

ltem	Description
1	Units on the primary display, rem appears to the left during remote operation
2	Input value

#### c) Isolated Voltage and Current Display

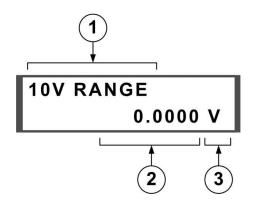


Figure 9 - Isolated Voltage and Current Display Layout

Item	Description
	Selected range and input mode:
	10V RANGE or 100V RANGE for DC voltage
1	50mA RANGE for basic DC current
	<ul> <li>24mA LPWR for loop powered 2 wire transmitter</li> </ul>
	• 24mA LPWR HART for loop powered 2 wire transmitter with 250 ohm resistor in circuit
2	Input value
3	Units

# 2.7 Error Messages

The following error messages may appear on either display.

Message	Description
Over Range	The value entered on the numeric keypad exceeds the range of the output mode selected.
Over Load For DC voltage output mode, the current required to generate the output exc CED 7000 specifications. For DC current mode, the resistance of the circuit e the CED 7000 specifications	
OL	For input modes, the measured value exceeds the upper limit of the selected input mode range. For output modes, when the range is locked, the present automatically recalled preset setpoint exceeds the upper limit of the locked range. The output is set to zero for the duration of this setpoint.
-OL	For input modes, the measured value exceeds the lower limit of the selected input mode range.

# Table 1 - Error Messages

# 3. Getting Started

After unpacking the CED 7000 and becoming familiar with the layout and general operation of the unit as described in the previous section, it is ready to set up for operation.

The following steps should be followed to set up the CED 7000 for operation:

a) **Before** attaching the power cord to the rear connector, check that the line voltage selector is set appropriately for your location. The CED 7000 is shipped from the factory with the line voltage set for the country of purchase. To verify the line voltage setting, check the indicator on the power line voltage selector and fuse compartment cover; see figure 5 in section 2.5 for the location.

Confirm that the setting is correct according to the following guidelines:

Line Voltage (50/60Hz)	Selector Position	
90 to 135 VAC	120 VAC position	
220 to 250 VAC	240 VAC position	

If the setting is not correct, follow the instructions in section 11.3 to change it.

- b) Once the voltage selection has been made, making sure that the power switch is off, connect the AC power cord to the CED 7000; see figure 5 in section 2.5 for the location.
- c) Turn on the CED 7000 using the rear panel mounted rocker switch. The CED 7000 should power up within a few seconds, briefly displaying the model number and firmware version in the primary display before reverting to the normal input/output display.

**NOTE:** If a proper power up display does not occur within 30 seconds, turn the power off, wait a few seconds, and repower the unit. If the problem persists, report the problem to WIKA immediately.

Warm up time is twice the time since last warmed up, to a maximum of 30 minutes. For good stability it is best to leave the CED 7000 on all the time.

# 4. Primary Inputs and Outputs

# 4.1 DC Voltage Output

The CED 7000 can source DC voltages from 0 V to 100 V, using the following four ranges for maximum accuracy: .1 V, 1 V, 10 V, and 100 V.

- a) Disconnect any test leads from external devices.
- b) Press the key to select DC voltage and current mode, if not already selected. If DC current mode is displayed, press the key again to cycle to DC voltage mode.
- c) Connect the unit under test to the voltage output terminals of the CED 7000 as shown in figure 10.

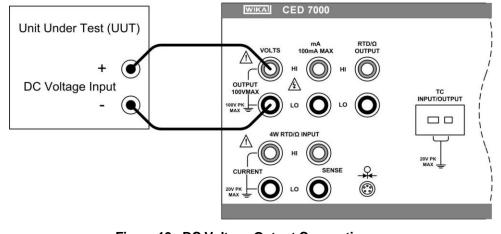


Figure 10 - DC Voltage Output Connection

d) Use the numeric keypad to enter the desired output value and press the **ENTER** key.

Alternatively, use the v or v cursor key to select a digit to modify, followed by the

cursor key to ramp the digit up or down. This method offers a simple solution when small changes to an output value are required, or if specific decades need to be incremented or decremented.

e) When DC voltage mode is first selected, the CED 7000 is placed in the standby (Stby) mode which puts the positive (+) output jack into a high impedance state

(>100k ohm) for safety. To place the output into the active state, press the key which toggles between the standby and operate modes.

The standby mode is also activated in the following situations:

• If a fault occurs during operation, such as an overload or short circuit condition.

• As a safety feature for all new outputs over 30 VDC. Refer to the product specification section of this manual for maximum drive currents.

• Warning. Scrolling the output when the output value is already over 30V will not place the CED 7000 in standby mode for each new value.


• Warning. Automatic setpoints over 30V will not place the CED 7000 in standby mode for each new value.

f) The CED 7000 can be locked to a specific voltage range by entering a value in that range and then selecting the secondary RNG LOCK function by pressing the secondary and keys.

# 4.2 DC Current Output

The CED 7000 can source DC current from 0 mA to 100 mA.

- a) Disconnect any test leads from external devices.
- b) Press the key to select DC voltage and current mode, if not already selected. If DC voltage mode is displayed, press the key again to cycle to DC current mode.
- c) Connect the unit under test to the current output terminals of the CED 7000 as shown in figure 11.

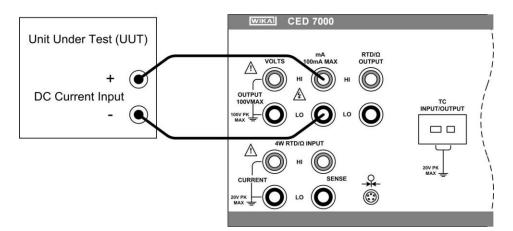

#### Figure 11 - DC Current Output Connection

d) Use the numeric keypad to enter the desired output value and press the **ENTER** key.

Alternatively, use the v or v cursor key to select a digit to modify, followed by the

or cursor key to ramp the digit up or down. This method offers a simple solution when small changes to an output value are required, or if specific decades need to be incremented or decremented.

 e) When DC current mode is first selected, the CED 7000 is placed in the standby (Stby) mode which puts the positive (+) output jack into a high impedance state (>100k ohm) for safety. To

place the output into the active state, press the **STRY** key which toggles between the standby and operate modes.

The standby mode is also activated in the following situations:

- No connection made to the output terminals.
- The voltage compliance for a given output current is exceeded. The CED 7000 has a typical voltage compliance of 10V so that 4-20mA application loads of up to 500 ohms can be driven. At maximum current of 100mA, the maximum load is 100 ohms.

#### 4.3 Resistance Temperature Detector (RTD) and Ohms Measure


The CED 7000 can measure all common RTD types, 5 custom RTD curves, and a custom SPRT in °F or °C, plus basic resistance from 0 to 4000 ohms.

The following common RTD types are supported:

Pt 385	100Ω, 200Ω, 500Ω, 1000Ω
Pt 3926	100Ω
Pt 3916 (JIS)	100Ω
Ni120	120Ω
Cu 427 (Minco)	10Ω
YSI 400	

- a) Disconnect any test leads from external devices.
- b) Press the  $\frac{12}{RD}$  key to select thermocouple and RTD/ $\Omega$  mode, if not already selected. If thermocouple mode is displayed, press the key again to cycle to RTD/ $\Omega$  mode.
- c) If output mode is displayed, select input mode by pressing the select and we keys.
- d) Press the key to select the desired RTD type, the custom curve, the SPRT, or the desired ohms range. The set up and use of custom RTD coefficients is described in section 4.5. The set up and use of SPRT coefficients is described in section 4.6.
- e) Connect the unit under test to the 4 wire RTD/ $\Omega$  input terminals of the CED 7000 as shown in

figure 12.

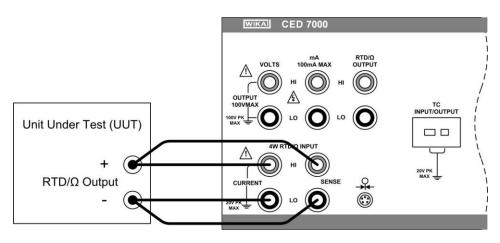



- f) Press the  $\frac{1}{2}$  and  $\frac{6}{2}$  keys to toggle the RTD display between °F and °C.
- g) For best accuracy, it is advisable to zero the RTD resistance circuit(s) daily, or if the CED 7000 is being used outside of the ambient temperature range of 18 to 28 °C. The maximum offset from unit calibration that can be zeroed out is ±0.1 ohm for the high range and ±0.01 ohm for the low range.

To zero a RTD resistance circuit:

- Select the RTD measure function as described above, and press the key until the low or high ohms range is selected.
- Short the RTD/ $\Omega$  terminals with the test leads normally used for RTD/ $\Omega$  measurements.
- Allow at least 3 minutes for the test leads and terminals to stabilize to the same temperature.

• Press the shift and very keys to zero the ohms range.


#### 4.4 Resistance Temperature Detector (RTD) and Ohms Source

The CED 7000 can source all common RTD types and 5 custom RTD curves in °F or °C, plus basic resistance from 5 to 4000 ohms.

The following common RTD types are supported:

Pt 385	100Ω, 200Ω, 500Ω, 1000Ω
Pt 3926	100Ω
Pt 3916 (JIS)	100Ω
Ni120	120Ω
Cu 427 (Minco)	10Ω
YSI 400	

- a) Disconnect any test leads from external devices.
- b) Press the  $\frac{1}{RD}$  key to select thermocouple and RTD/ $\Omega$  mode, if not already selected. If thermocouple mode is displayed, press the key again to cycle to RTD/ $\Omega$  mode.
- c) If input mode is displayed, select output mode by pressing the shirt and keys.
- d) Press the key to select the desired RTD curve or ohms range. The set up and use of custom RTD coefficients is described in section 4.5.
- e) Connect the unit under test to the RTD/Ω output terminals of the CED 7000 as shown in figure 13.

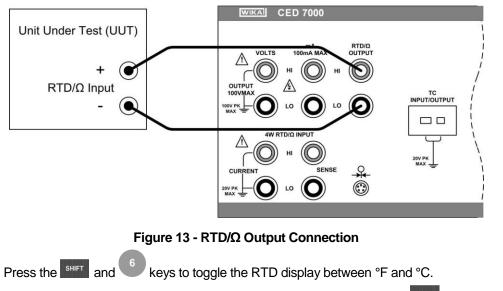

g) Use the numeric keypad to enter the desired output value and press the **ENTER** key.

f)

Alternatively, use the v or v cursor key to select a digit to modify, followed by the



or cursor key to ramp the digit up or down. This method offers a simple solution when small changes to an output value are required, or if specific decades need to be incremented or decremented.

h) When RTD/Ω mode is first selected, the CED 7000 is placed in the standby (Stby) mode which puts the positive (+) output jack into a high impedance state (>100k ohm) for safety. To place the output into the active state, press the stard which toggles between the standby and operate modes.

# 4.5 Resistance Temperature Detector (RTD) with Custom Coefficients

The CED 7000 has the capability to store coefficients for up to 5 custom RTD curves. To enter the coefficients for a custom RTD curve:

- a) Select RTD measure or source mode as described in the preceding sections.
- b) Press the **UNITS** key until the USR\_DEF type is selected.
- c) Press the ENTER key to display the curve selection prompt "RTD CUSTOM (1-5)".
- d) Press the numeric key corresponding to the custom RTD curve to be entered.
- e) At the "SET(1)/RECALL(2)" prompt, press U to select custom RTD curve data entry.
- f) At the "ENTER MIN TEMP" prompt, enter the minimum temperature limit for the custom RTD curve, and press the enter key.
- g) At the "ENTER MAX TEMP" prompt, enter the maximum temperature limit for the custom RTD curve, and press the **ENTER** key.
- h) At the "ENTER R0" prompt, enter the nominal resistance value (R0) for the custom RTD curve, and press the ENTER key.
- i) At the "ENTER COEFF A" prompt, enter the first (A) coefficient for the custom RTD curve, and press the ENTER key. To enter a coefficient that includes an exponent, enter the mantissa, press the SHIFT and keys to select the EXP function, enter the exponent,

and press the ENTER key.

- j) When prompted, enter the second (B) and third (C) coefficients in the same manner.
- k) To abort the curve entry without saving any changes, press the key.

To use a custom RTD curve:

- a) Select RTD measure or source mode as described in the preceding sections.
- b) Press the key until the USR\_DEF type is selected.
- c) Press the ENTER key to display the curve selection prompt "RTD CUSTOM (1-5)".
- d) Press the numeric key corresponding to the custom RTD curve to be used.
- e) At the "SET(1)/RECALL(2)" prompt, press <sup>2</sup> to recall the custom RTD curve coefficients.
- f) To use a different custom RTD curve, press the RD key twice to display the USR\_DEF selection prompt.

The USR\_DEF function of the CED 7000 uses the Calendar-Van Dusen equation for sourcing and measuring custom RTD's. The C coefficient is only used for the subrange -260 to 0 degrees Celsius. Only the A and B coefficients are needed for the subrange 0 to 630 degrees. The R0 value is the resistance of the probe at 0 degrees Celsius.

All 5 of the custom RTD curves are set to PT385 at the factory, as shown in Table 2.

Curve	Subrange	R0	Coefficient A	Coefficient B	Coefficient C
1	0 to 630	100	3.9083e10-3	-5.775e10-7	0
2	-260 to 0	100	3.9083e10-3	-5.775e10-7	-4.183e10-12
3	0 to 630	100	3.9083e10-3	-5.775e10-7	0
4	-260 to 0	100	3.9083e10-3	-5.775e10-7	-4.183e10-12
5	0 to 630	100	3.9083e10-3	-5.775e10-7	0

#### Table 2 - Default Custom RTD Coefficients

Table 3 shows the coefficients for RTD types PT391 and PT392. The C coefficient is only used for temperatures below 0 degrees Celsius.

RTD Type	R0	Coefficient A	Coefficient B	Coefficient C
PT392	100	3.9848e10-3	-5.87e10-7	-4.0e10-12
PT391	100	3.9692e10-3	-5.8495e10-7	-4.2325e10-12

#### Table 3 - Other Common RTD Coefficients

# 4.6 Standard Platinum Resistance Thermometer (SPRT) Coefficients

The SPRT function of the CED 7000 uses ITS-90 standard coefficients as a basis for measuring a SPRT. The five custom coefficients are entered as deviations from the standard coefficients, and as such, all of them are set to zero at the factory.

The coefficients A- and B- represent the  $A_4$  and  $B_4$  coefficient, obtained when the SPRT is calibrated at the triple points of argon, mercury and water. This covers the 83.8058K to 273.16K subrange. Coefficients A, B and C can represent different coefficients based on which subranges of the SPRT has been calibrated. For example, if the 273.15K to 933.473K subrange was used, A, B and C would represent  $A_7$ ,  $B_7$  and  $C_7$  whereas if the 273.15K to 692.67K subrange was used, A and B would represent  $A_8$  and  $B_8$  and C=0.

To enter the deviation coefficients for a custom SPRT:

- a) Select RTD measure mode as described in the preceding section.
- b) Press the **TYPE** key until the SPRT type is selected.

- c) Press the ENTER key to display the action prompt "SET(1)/RECALL(2)".
- d) Press U to select custom SPRT data entry.
- e) At the "ENTER MIN TEMP" prompt, enter the minimum temperature limit for the custom SPRT, and press the ENTER key.
- f) At the "ENTER MAX TEMP" prompt, enter the maximum temperature limit for the custom SPRT, and press the ENTER key.
- g) At the "ENTER RTPW" prompt, enter the nominal resistance value (RTPW) for the custom SPRT, and press the ENTER key.
- h) At the "ENTER COEFF A" prompt, enter the first (A) deviation coefficient for the custom SPRT, and press the ENTER key. To enter a coefficient that includes an exponent, enter the mantissa, press the SHIFT and keys to select the EXP function, enter the exponent, and press the ENTER key.
- i) When prompted, enter the second (B), third (C), fourth (A-), and fifth (B-) deviation coefficients in the same manner.
- j) To abort the SPRT entry without saving any changes, press the RD key.

To use a custom SPRT:

- a) Select RTD measure mode as described in the preceding section.
- b) Press the **TYPE** key until the SPRT type is selected.
- c) Press the ENTER key to display the action prompt "SET(1)/RECALL(2)".
- d) Press <sup>2</sup> to recall the custom SPRT curve coefficients.
- e) To use a different custom SPRT, press the RD key twice to display the SPRT selection prompt.

# 4.7 Thermocouple (T/C) Measure

The CED 7000 can measure all common thermocouple types in °F or °C, plus basic millivolts from -10.0 to 75.0 mV.

The following common thermocouple types are supported:

B, C, E, J, K, L, N, R, S, T, U, XK, BP

- a) Disconnect any test leads from external devices.
- b) Press the  $\frac{12}{RD}$  key to select thermocouple and RTD/ $\Omega$  mode, if not already selected. If RTD/ $\Omega$  mode is displayed, press the key again to cycle to thermocouple mode.
- c) If output mode is displayed, select input mode by pressing the shift and weys.
- d) Press the **TYPE** key to select the desired thermocouple type or the millivolt range.
- e) Connect the unit under test to the thermocouple terminals of the CED 7000 using a standard T/C miniplug as shown in figure 14. One pin is wider than the other; do not attempt to force the plug in the wrong polarization. The T/C wire used for the connection must match the thermocouple type selected for proper cold junction compensation. If the CED 7000 and the T/C miniplug are at different temperatures, wait at least 3 minutes for the miniplug and terminals to stabilize to the same temperature.

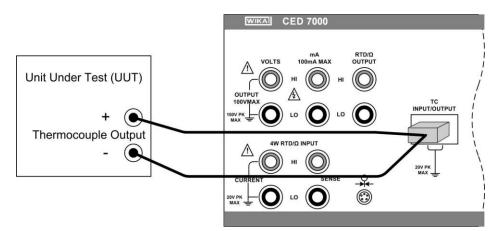


Figure 14 - Thermocouple Input Connection

- f) Press the shift and <sup>6</sup> keys to toggle the thermocouple display between °F and °C.
- g) Press the shift and keys to toggle the cold junction compensation between the internal temperature sensor and an external reference.
- h) For best accuracy, it is advisable to zero the T/C millivolt circuit daily, or if the CED 7000 is being used outside of the ambient temperature range of 18 to 28 °C. The maximum offset from unit calibration that can be zeroed out is ±1 mV.

To zero the T/C millivolt circuit:

- Select the thermocouple measure function as described above, and press the willivolt range is selected.
- Insert the supplied thermocouple shorting jumper into the thermocouple terminals.
- Allow at least 3 minutes for the jumper and terminals to stabilize to the same temperature.

• Press the shift and exercise to zero the T/C millivolt circuit.


#### 4.8 Thermocouple (TC) Source

The CED 7000 can source all common thermocouple types in °F or °C, plus basic millivolts from -10.0 to 75.0 mV.

The following common thermocouple types are supported:


B, C, E, J, K, L, N, R, S, T, U, XK, BP

- a) Disconnect any test leads from external devices.
- b) Press the  $\frac{R}{RD}$  key to select thermocouple and RTD/ $\Omega$  mode, if not already selected. If RTD/ $\Omega$  mode is displayed, press the key again to cycle to thermocouple mode.
- c) If input mode is displayed, select output mode by pressing the and weys.
- d) Press the **TYPE** key to select the desired thermocouple type or the millivolt range.
- e) Connect the unit under test to the thermocouple terminals of the CED 7000 using a standard T/C miniplug as shown in figure 15. One pin is wider than the other; do not attempt to force the plug in the wrong polarization. The T/C wire used for the connection must match the thermocouple type selected for proper cold junction compensation. If the CED 7000 and the T/C miniplug are at different temperatures, wait at least 3 minutes for the miniplug and terminals to stabilize to the same temperature.

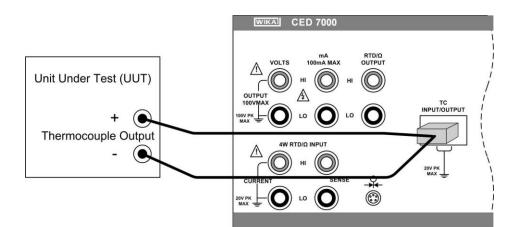



- f) Press the shift and we keys to toggle the thermocouple display between °F and °C.
- g) Press the shift and temperature sensor and an external reference.
- h) Use the numeric keypad to enter the desired output value and press the **ENTER** key.

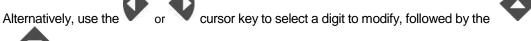

or cursor key to ramp the digit up or down. This method offers a simple solution when small changes to an output value are required, or if specific decades need to be incremented or decremented.

 For best accuracy, it is advisable to zero the T/C millivolt circuit daily, or if the CED 7000 is being used outside of the ambient temperature range of 18 to 28 °C. This procedure is described in section 4.7 on thermocouple measurements.

#### 4.9 Pressure Measure

The CED 7000 can support the following types of pressure modules:

- Martel Electronics Corporation BETA Port-P Modules
- Fluke Corporation Model 700 Series Modules
- Mensor Corporation Model 6100 Modules

For applications that require very high accuracy the Mensor 6100 Series will yield the best accuracy. a) Connect the pressure module to the CED 7000 as shown in figure 16.

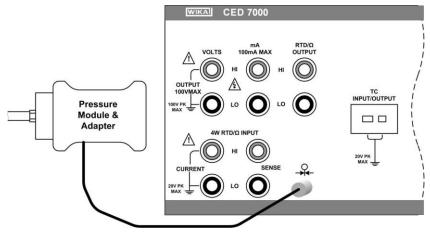


Figure 16 - Pressure Module Connection

b) Press the key. The CED 7000 automatically senses which pressure module is attached

and sets its range accordingly.

- c) Press the **UNTE** key to select the desired pressure units for display.
- d) Before attaching the module to the pressure source, zero the module as described in the instruction sheet that came with the module. Procedures vary, but all end with pressing the shert and exercise keys.

e)Attach the module to the pressure source according to the instruction sheet that came with the module, taking care to follow all safety precautions when dealing with high pressures.

# 5. Isolated Inputs

# 5.1 Voltage Input

The CED 7000 can measure DC voltages from 0 V to 100 V, using the following two ranges for maximum accuracy: 10 V, and 100 V.

- a) Disconnect any test leads from external devices.
- b) Press the VOLTS key to select isolated DC voltage and current input mode, if not already selected. If the desired DC voltage mode is not displayed, press the key again to cycle to the desired DC voltage mode.
- c) Connect the unit under test to the isolated voltage/current input terminals of the CED 7000 as shown in figure 17.

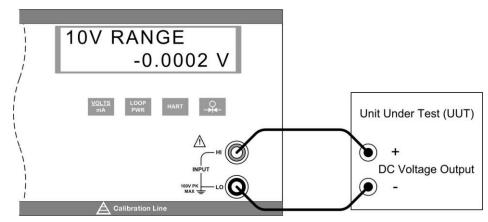


Figure 17 - Isolated DC Voltage Input Connection

# 5.2 Current Input

The CED 7000 can measure DC current from 0 mA to 50 mA.

- a) Disconnect any test leads from external devices.
- b) Press the key to select isolated DC voltage and current input mode, if not already selected. If the DC current mode is not displayed, press the key again to cycle to it.
- c) Connect the unit under test to the isolated voltage/current input terminals of the CED 7000 as shown in figure 18.

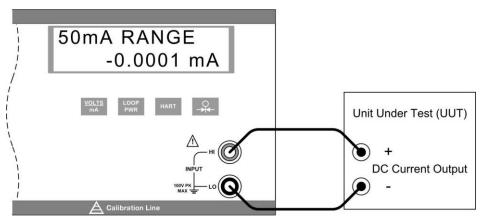


Figure 18 - Isolated DC Current Input Connection

d) If the UUT is a 2 wire loop powered transmitter that is disconnected from the wiring, press the key to activate the CED 7000 internal 24V supply in series with the current measuring circuit. The top line changes to 24mA LPWR to indicate that the supply is activated. Press the

circuit. The top line changes to 24mA LPWR to indicate that the supply is activated. Press the key again to deactivate the supply, and the top line reverts to 50mA RANGE.

e) If a 250 ohm resistor is required during a HART calibration procedure, press the HART key to switch in the CED 7000 internal 250 ohm resistor. The word HART is appended to the top line of the display to indicate that the resistor is switched in. Press the key again to switch out the resistor, and the display reverts to its previous state. This resistor lowers the maximum load driving capability from 1000 ohms at 20 mA to 750 ohms at 20 mA.

# **5.3 Pressure Input**

The isolated pressure display uses the same physical pressure connector as the primary display. It is possible to have both displays selected to pressure simultaneously, showing the same source in different pressure units. See section 4.9 for a general discussion on pressure module selection.

a) Connect the pressure module to the CED 7000 as shown in figure 19.

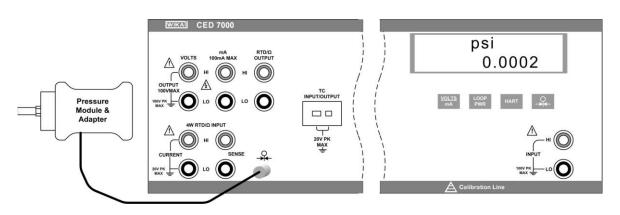


Figure 19 - Isolated Pressure Module Connection

- b) Press the key. The CED 7000 automatically senses which pressure module is attached and sets its range accordingly.
- c) If necessary, press the key again to cycle through the pressure units until the desired one is displayed.
- d) Before attaching the module to the pressure source, zero the module as described in the instruction sheet that came with the module. Procedures vary, but all end with pressing the shert and keys.
- e) Attach the module to the pressure source according to the instruction sheet that came with the module, taking care to follow all safety precautions when dealing with high pressures.

# 6. Output Setpoints

Nine preset output setpoints may be stored and recalled for each of the following output modes:

- Voltage
- Current
- · each thermocouple type, including millivolts
- each RTD type, including each of the five custom curves.

They may be recalled on an individual basis, or as an automatic up and down cycle with a configurable dwell time between each setpoint. The automatic cycle feature always starts at setpoint number 1, stepping up to a user specified ending setpoint number, then back down in reverse order, and then repeats.

To set a setpoint:

- a) Select the output mode.
- b) Enter the output value for the setpoint.
- c) Press the select the SET function.
- d) At the setpoint number selection prompt "SET POINT#", press the numeric key, 1 to 9, corresponding to the setpoint to be set.
- e) If the automatic cycle feature is to be used, care should be taken to order the setpoint values in an appropriate manner. It always cycles between setpoint number 1 and a user specified ending setpoint number. The values in the cycled group of setpoints should be entered with this in mind. Any random setpoints used for individual checks can then be located after the usual ending setpoint number.

To recall a single setpoint:


- a) Select the output mode.
- b) Press the select the RECALL function.
- c) At the setpoint number selection prompt "RECALL SPT#", press the numeric key, 1 to 9, corresponding to the setpoint to be recalled.

To start an automatic setpoint cycle:

- a) Select the output mode.
- b) Press the  $\frac{1}{2}$  and  $\frac{3}{2}$  keys to select the AUTOSET function.
- c) At the ending setpoint number selection prompt "AUTO SET POINT", press the numeric key, 1 to 9, corresponding to the ending setpoint number for the cycle.
- d) At the dwell time prompt "DWELL TIME", "5-500?", enter the number of seconds, 5 to 500, to dwell at each setpoint value, followed by the **ENTER** key.
- e) The expression of the cycle without stopping it.
- f) Press any other key to terminate the cycle.

# 7. Application Notes

# 7.1 P/I Transmitter

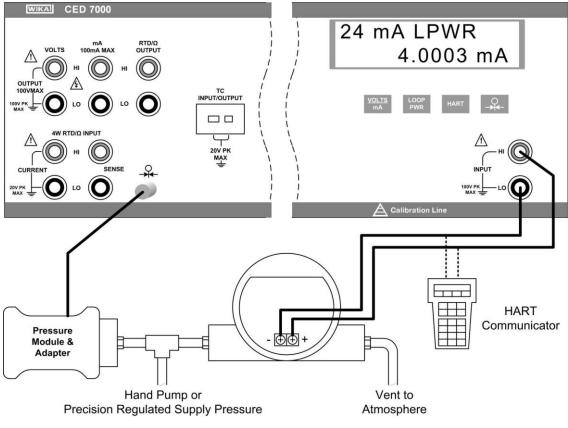

#### Figure 20 - P/I Transmitter Application

- 1. Disconnect any test leads from external devices.
- 2. Select pressure input on the primary display as described in section 4.9.
- 3. Select current input on the isolated display as described in section 5.2. Select the isolated loop power option. If a HART communicator is to be used for set up of the transmitter, select the HART option.
- 4. Connect the transmitter as shown in figure 20.
- 5. Test and calibrate the transmitter per the manufacturer's instructions.

# 7.2 I/P Transmitter

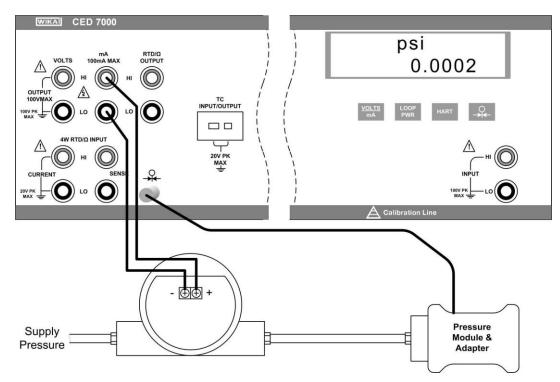


Figure 21 - I/P Transmitter Application

- 1. Disconnect any test leads from external devices.
- 2. Select current output on the primary display as described in section 4.2.
- 3. Select pressure input on the isolated display as described in section 5.3
- 4. Connect the transmitter as shown in figure 21.
- 5. Test and calibrate the transmitter per the manufacturer's instructions.

# 7.3 V/I Transmitter

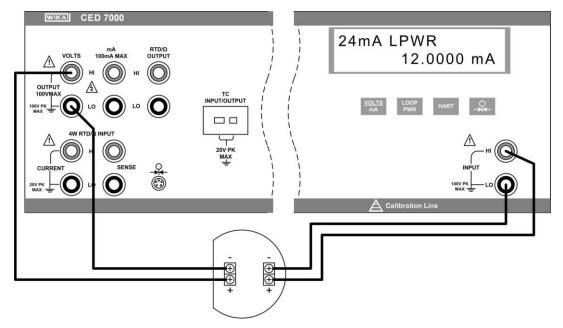


Figure 22 - V/I Transmitter Application

- 1. Disconnect any test leads from external devices.
- 2. Select voltage output on the primary display as described in section 4.1

3. Select current input on the isolated display as described in section 5.2. Select the isolated loop power option.

- 4. Connect the transmitter as shown in figure 22.
- 5. Test and calibrate the transmitter per the manufacturer's instructions.

# 7.4 RTD Test

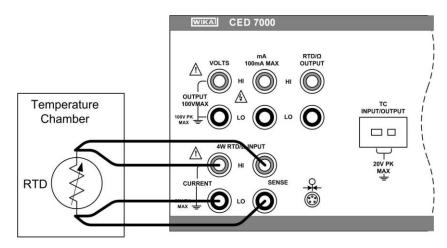


Figure 23 - RTD Test Application

- 1. Disconnect any test leads from external devices.
- 2. Select RTD input on the primary display as described in section 4.3. Select the RTD type which corresponds to the RTD being tested.
- 3. Connect the RTD as shown in figure 23.
- 4. Test the RTD per the manufacturer's instructions.

# 7.5 RTD Transmitter

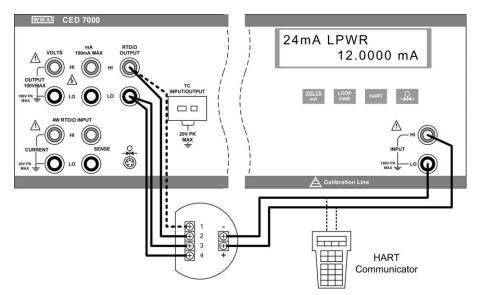


Figure 24 - RTD Transmitter Application

- 1. Disconnect any test leads from external devices.
- 2. Select RTD output on the primary display as described in section 4.4. Select the RTD type which corresponds to the transmitter being tested.
- 3. Select current input on the isolated display as described in section 5.2. Select the isolated loop power option. If a HART communicator is to be used for set up of the transmitter, select the HART option.
- 4. Connect the transmitter as shown in figure 24.
- 5. Test and calibrate the transmitter per the manufacturer's instructions.

#### 7.6 Thermocouple Test

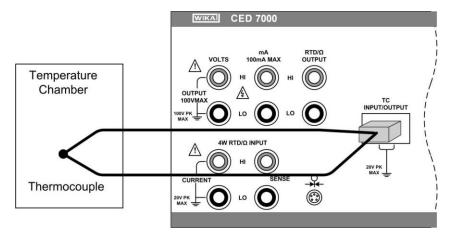


Figure 25 - Thermocouple Test Application

1. Disconnect any test leads from external devices.

2. Select thermocouple input on the primary display as described in section 4.7. Select the thermocouple type which corresponds to the thermocouple being tested.

- 3. Connect the thermocouple as shown in figure 25.
- 4. Test the thermocouple per the manufacturer's instructions.

# 7.7 Thermocouple Transmitter

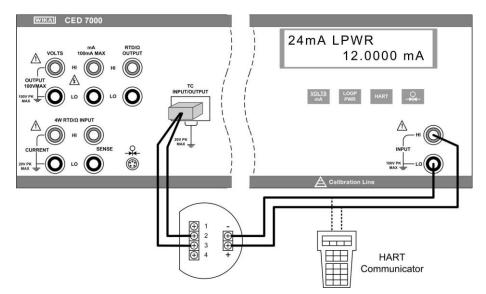


Figure 26 - Thermocouple Transmitter Application


1. Disconnect any test leads from external devices.

2. Select thermocouple output on the primary display as described in section 4.8. Select the thermocouple type which corresponds to the transmitter being tested.

3. Select current input on the isolated display as described in section 5.2. Select the isolated loop power option. If a HART communicator is to be used for set up of the transmitter, select the HART option.

- 4. Connect the transmitter as shown in figure 26.
- 5. Test and calibrate the transmitter per the manufacturer's instructions.

# 7.8 RTD Indicator

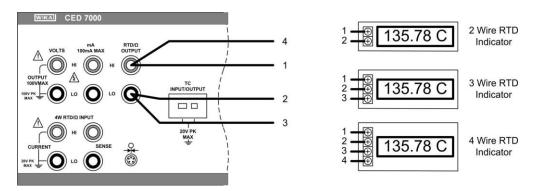

#### Figure 27 - RTD Indicator Application

- 1. Disconnect any test leads from external devices.
- 2. Select RTD output on the primary display as described in section 4.4. Select the RTD type which corresponds to the indicator being tested.
- 3. Connect the indicator as shown in figure 27.
- 4. Test and calibrate the indicator per the manufacturer's instructions.

#### 7.9 Precision Current Trip


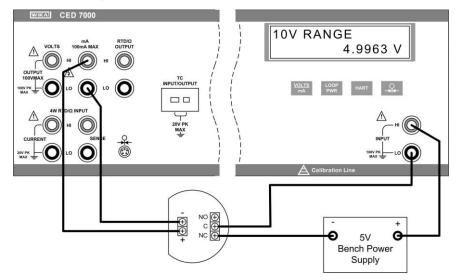


Figure 28 - Precision Current Trip Application

- 1. Disconnect any test leads from external devices.
- 2. Select current output on the primary display as described in section 4.2.
- 3. Select voltage input on the isolated display as described in section 5.1.
- 4. Connect the trip as shown in figure 28.
- 5. Test and calibrate the trip per the manufacturer's instructions.


# 7.10 I/I Isolator/Transmitter

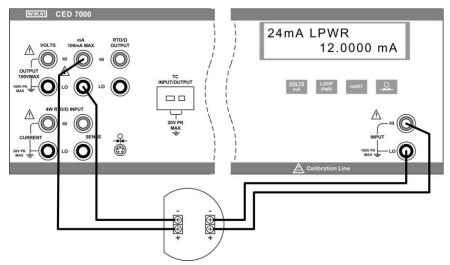

#### Figure 29 - I/I Isolator/Transmitter Application

- 1. Disconnect any test leads from external devices.
- 2. Select current output on the primary display as described in section 4.2.
- 3. Select current input on the isolated display as described in section 5.2. Select the isolated loop power option.
- 4. Connect the transmitter as shown in figure 29.
- 5. Test and calibrate the transmitter per the manufacturer's instructions.

# 7.11 Precision Temperature Measurement with IBP-2 Probe

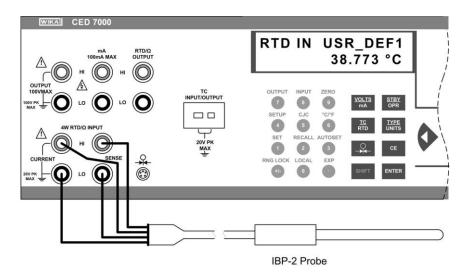

#### Figure 30 - Precision Temperature Measurement with IBP-2 Probe

- 1. With the IBP-2 probe and the corresponding custom coefficients, the total system error is 0.03°C.
- 2. Disconnect any test leads from external devices.

3. Select RTD input on the primary display as described in section 4.3. Select the user defined curve containing the custom coefficients for the IBP-2. If custom coefficients have not yet been entered for the IBP-2, follow the instructions in section 4.5 to do so.

4. Connect the probe as shown in figure 30.

# 8. LCD and Remote Interface Setup Procedures

These procedures are accessed in sequence as follows:

- a) Press the select the SETUP function.
- b) At the "LCD CONTRAST" prompt, press the or key to adjust the LCD contrast level. When complete, press the ever key.
- c) At the "LCD BACKLIGHT" prompt, press the or key to adjust the LCD backlight level. When complete, press the enter key.
- d) At the "Remote Interface" prompt, press the vor very to select the RS-232 interface or the GPIB interface. When the desired interface is selected, press the ENTER key.
- e) If the GPIB interface was selected, the "GPIB Address" prompt appears. Press the

or key to ramp through the possible addresses, 0 to 30. When the desired address is displayed, press the **ENTER** key.

# 9. Remote Interface

#### 9.1 Introduction

The CED 7000 can be controlled remotely from a personal computer (PC) using either a RS-232 serial connection or an IEEE-488 parallel connection (also called a General Purpose Interface Bus, or GPIB, connection). In either case, individual commands can be typed into a terminal emulator program suitable for the connection type, or the calibrator can be controlled by an automated PC program using the CED 7000 command set. You can write your own automated PC program, or it may be possible to purchase a suitable third party program and configure it for the CED 7000. Compatible software for IEEE-488 operation, MET/CAL, may be purchased from Fluke.

The RS-232 connection allows one CED 7000 to be connected to one PC. The communications speed is slower than IEEE-488, but no extra equipment is required other than a low cost null modem cable.

The IEEE-488 connection allows up to 15 different calibrators, PC's, and items of test equipment to be connected together in a bus arrangement. The communications speed is much faster than RS-232, but it requires the purchase and installation of special PC interface card(s) and connecting cable(s).

This section describes the set up of the two types of connections, and the general operation of the command set. Section 10 describes the individual commands in detail.

# 9.2 Setting up the RS-232 Port for Remote Control

The CED 7000 is fully programmable over a standard RS-232 link with a PC. The RS-232 cable length for the port should not exceed 15 meters (50 feet), although longer cable lengths are permitted if the load capacitance measured at a connection point (including signal terminator) does not exceed 2500 pF.

The serial communications parameters in the CED 7000 are fixed at the following values:

- 9600 baud
- 8 data bits
- 1 stop bit
- no parity
- Xon/Xoff
- EOL (end-of-line) character CR (Carriage Return)

A typical RS-232 connection is shown in Figure 31. Note the use of a null modem cable for the

connection. See section 2.5 for the location of the RS-232 port on the rear panel of the CED 7000.

### 9.2.1 Using the CED 7000 on Computers with USB Ports

The CED 7000 can be used with a computer having only USB ports with the use of a USB to serial converter. WIKA can provide the following equipment to support this connection:

- Cable, USB to serial adapter
- Cable, Null modem, RS-232

Please check with the factory or your local distributor for pricing and availability.

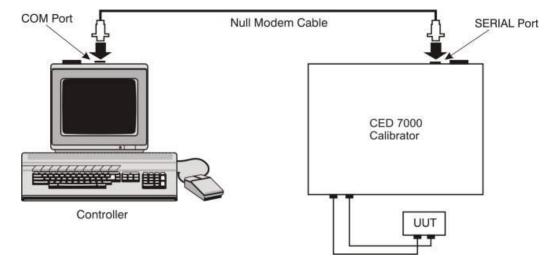


Figure 31 - RS-232 Remote Connection

### 9.3 Setting up the IEEE-488 Port for Remote Control

The CED 7000 is fully programmable for use on a standard IEEE-488 interface bus. The IEEE-488 interface is also designed in compliance with supplemental standard IEEE-488.2, which describes additional IEEE-488 features. Devices connected to the IEEE-488 bus are designated as talkers, listeners, talker/listeners, or controllers. Under remote control of an instrument, the CED 7000 operates as a talker/listener.

A PC equipped with an IEEE-488 interface controls the CED 7000. Compatible software for IEEE-488 operation, MET/CAL, may be purchased from Fluke.

When using the IEEE-488 remote control interface, there are two restrictions:

• A maximum of 15 devices can be connected in a single IEEE-488 bus system.

• The total length of IEEE-488 cables used in one IEEE-488 bus system is 2 meters times the number of devices in the system, or 20 meters, whichever is less.

See section 8 for instructions on configuring the CED 7000 for IEEE-488 (GPIB) operation, including selecting the interface and the bus address.

A typical IEEE-488 (GPIB) connection is shown in Figure 32. See section 2.5 for the location of the IEEE-488 (GPIB) port on the rear panel of the CED 7000.

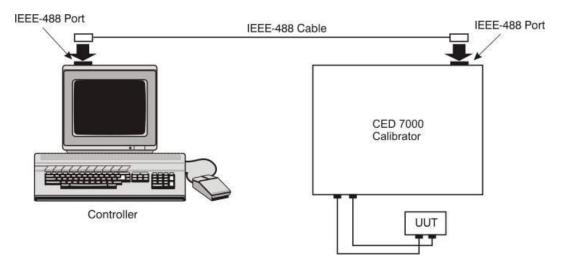


Figure 32 - IEEE-488 (GPIB) Remote Connection

### 9.4 Changing Between Local and Remote Operation

In addition to local mode (front panel operation) and remote, the CED 7000 can be placed into a local lockout condition at any time by command of the controller. Combined, the local, remote, and lockout conditions yield four possible operating states as follows.

a) Local State

The CED 7000 responds to local and remote commands. This is normal front panel operation. All remote commands received by the CED 7000 are processed.

b) Local with Lockout State

Local with lockout is identical to local, except that the CED 7000 will go into the remote with lockout state instead of the remote state when it receives a remote command. This state can only be entered by sending the IEEE-488 command GTL (Go To Local) when in the remote with lockout state.

c) Remote State

When the CED 7000 is placed in remote, either via a RS-232 REMOTE command, or via the IEEE-488 asserting the REN line, it enters the remote state. The left end of the top line of the display changes to: rem.

Front panel operation is disabled except for the LOCAL (0) key. Pressing the LOCAL key, using RS-232 to send the LOCAL command, or IEEE-488 to send the GTL (Go To Local) message, returns the CED 7000 to the local state.

d) Remote with Lockout State

When the CED 7000 is placed in lockout, either via a RS-232 LOCKOUT command, or via the IEEE-488 message LLO (Local Lockout), the CED 7000 front panel controls are totally locked out. The left end of the top line of the display changes to: rem.

To return the CED 7000 to the local with lockout state, send the RS-232 LOCAL command or the IEEE-488 GTL (Go To Local) message.

Table 4 summarizes the possible operating state transitions. For more information on IEEE-488 GPIB messages, see section 9.5.

From	То	Front Panel	Front Panel GPIB Message	
Local	Remote Local with Lockout		MLA (REN True) LLO	REMOTE LOCKOUT
Remote	Local Remote with Lockout	Local 0 key	GTL or REN False LLO	LOCAL LOCKOUT
Local with Lockout	Local Remote with Lockout		REN False MLA (REN True)	LOCAL REMOTE
Remote with Lockout	Local Local with Lockout		REN False GTL	LOCAL

Table 4 - Operating State Transitions

### 9.5 IEEE-488 Interface Overview

The IEEE-488 parallel interface sends commands as data and receives measurements and messages as data. The maximum data exchange rate is 1 Mbyte per second, with a maximum distance of 20 meters for the total length of the connecting cables. A single cable should not exceed 4 meters in length.

Several commands are used only for RS-232 serial operation because these functions must be implemented as IEEE uniline (single control line) bus management messages per the IEEE Standards. For example, the command REMOTE could be sent as data over the IEEE-488 interface to place the CED 7000 into remote operating mode, but it is not because the IEEE Standards call for the remote function to be sent to the device as the uniline message REN. This is also true for several other commands and functions, as shown in table 5 below with their RS-232 equivalents.

IEEE-488 Message	RS-232 Equivalent
GTL	LOCAL command
GTR	REMOTE command
LLO	LOCKOUT command
SDC, DCL	(not emulated on RS-232)
GET	(not emulated on RS-232)
SPE, SPD	(not emulated on RS-232)
UNL, UNT	(not emulated on RS-232)

Table 5 - RS-232 Emulation of IEEE-488 Messages

The IEEE-488 interface is based on the IEEE Standards 488.1 and 488.2. For detailed information, refer to the IEEE-488.1 and IEEE-488.2 standards.

### 9.6 Using Commands

Communications between the controller and the CED 7000 consist of commands, queries, and interface messages. Although the commands are based on the 488.2 standard, they can be used on either the IEEE-488 or RS-232 interface, except for a few specific RS-232 only commands as described in the subsection Commands for RS-232 Only below.

For more detailed information on IEEE command structures, see the IEEE 488.2 standard.

Refer to section 10 for more detailed information about the commands referenced in this section.

All commands, units, and text data may be entered in UPPER or lower case letters. The CED 7000 converts all lower case letters to upper case before processing.

### 9.6.1 Types of Commands

The commands for the CED 7000 can be grouped into the following categories based on how they function.

a) Device-Dependent Commands

Device-dependent commands are unique to the CED 7000. An example of a device-

dependent command is:

OUT 1 V

This command instructs the CED 7000 to source 1 volt DC.

b) Common Commands

Common commands are defined by the IEEE 488.2 standard and are common to most bus devices. Common commands always begin with an asterisk (\*) character. Common commands are available whether you are using the IEEE-488 or RS-232 interface for remote control. An example of a common command is:

\*IDN?

This command instructs the CED 7000 to return the instrument identification string.

c) Query Commands

Query commands request information, which may be returned as the command executes, or may be placed in a buffer until requested later. Query commands always end with a question mark. An example of a query commands is:

RANGE?

This command instructs the CED 7000 to return the present DC voltage output range.

d) Interface Messages (IEEE-488)

Interface messages manage traffic on the IEEE-488 interface bus. Device addressing and clearing, data handshaking, and commands to place status bytes on the bus are all directed by interface messages. Some of the interface messages occur as state transitions of dedicated control lines. The rest of the interface messages are sent over the data lines with the ATN signal true. All device-dependent and common commands are sent over the data lines with the ATN signal false.

An important thing to note about interface messages is that, unlike device-dependent and common commands, interface messages are not sent literally (in a direct way). They are converted to parallel signal levels on the bus data and control lines.

IEEE-488 standards define interface messages which are handled automatically in most cases.

e) Compound Commands

A compound command is two or more commands placed on a single command line separated from each other with semicolons. For example, consider the following two individual commands:

OUT 1 V

OPER

These could be combined into the compound command:

OUT 1 V; OPER

These commands instruct the CED 7000 to source 1 V DC, and then go into operate mode.

f) Overlapped Commands

Commands that begin execution but require slightly more time than the normal communication command/response interval to complete are called overlapped commands. This is because they can be overlapped by receipt the next command before they have been completed.

The detailed command descriptions in section 10 show a check mark T beside Overlapped for overlapped commands.

Use the command \*WAI to wait until the overlapped command has completed execution before executing the next command. For example:

OUT 1 V; \*WAI

You can also use the status commands \*OPC and \*OPC? to detect the completion of overlapped commands.

g) Sequential Commands

Commands that execute immediately are called sequential commands.

The detailed command descriptions in section 10 show a check mark T beside Sequential for sequential commands.

The majority of commands are sequential.

h) Commands for RS-232 Only

Several commands are used only for RS?232 serial operation because these functions must be implemented as IEEE uniline (single control line) bus management messages per the IEEE Standards. For example, the command REMOTE could be sent as data over the IEEE-488 interface to place the CED 7000 into remote operating mode, but it is not because the IEEE Standards call for the remote function to be sent to the device as the uniline message REN. This is also true for several other commands and functions, as shown in table 6 below with their RS-232 equivalents.

For these commands, the detailed command descriptions in section 10 show a check mark X beside RS-232, but no check mark beside IEEE-488.

IEEE-488 Message	RS-232 Equivalent
GTL	LOCAL command
GTR	REMOTE command
LLO	LOCKOUT command

### Table 6 - Commands for RS-232 Only

i) Commands for IEEE-488

These are all of the commands except for those used for RS-232 only, as described above. All commands are transferred over the IEEE-488 as data, except for the commands LOCAL, REMOTE, and LOCKOUT, which are implemented per the IEEE Standards as uniline messages.

The detailed command descriptions in section 10 show a check mark T beside IEEE-488 for these commands.

#### 9.6.2 Command Syntax

The following syntax rules apply to all of the remote commands. Information about the syntax of response messages is also given.

a) Parameter Syntax Rules

Table 7 lists the units accepted in command parameters and used in responses. All commands and units may be entered in upper or lower case.

Units	Meaning
uV	Volts in units of microvolts1
mV	Volts in units of millivolts1
V	Volts in units of volts
kV	Volts in units of kilovolts1
uA	Current in units of microamperes1
mA	Current in units of milliamps1
А	Current in units of amps
Ohm	Resistance in units of ohms
kOhm	Resistance in units of kilohms1
MOhm	Resistance in units of megohms1
cel	Temperature in degrees Celsius
far	Temperature in degrees Fahrenheit
psi	Pressure in pounds per square inch
mmHg	Pressure in millimeters of mercury at 0 °C
inHg	Pressure in inches of mercury at 0 °C

#### Table 7 - Units Accepted in Parameters and Used in Responses

inH2O4C	Pressure in inches of water at 4 °C
inH2O20C	Pressure in inches of water at 20 °C
inH2O60F	Pressure in inches of water at 60 °F
cmH2O4C	Pressure in centimeters of water at 4 °C
cmH2O20C	Pressure in centimeters of water at 20 °C
mmH2O4C	Pressure in millimeters of water at 4 °C
mmH2O20C	Pressure in millimeters of water at 20 °C
bar	Pressure in bar
mbar	Pressure in millibar
kPa	Pressure in kilopascals
МРа	Pressure in megapascals
kg/cm2	Pressure in kilograms per square centimeter

1 Parameter only

#### b) General Rules

The general rules for parameter usage are as follows:

- Numeric parameters may have up 15 significant digits and their value can be in the range +/-1.0E+/-20.
- Including too many or too few parameters causes a command error.
- Null parameters cause an error, e.g., the adjacent commas in OUT 1V, ,;OPER.
- Expressions, for example 4+2\*13, are not allowed as parameters.
- c) Extra Space or Tab Characters

In the command descriptions, parameters are shown separated by spaces. One space after a command is required (unless no parameters are required). All other spaces are optional. Spaces are inserted for clarity in the manual and may be left in or omitted as desired. You can insert extra spaces or tabs between parameters as desired. Extra spaces within a parameter are generally not allowed, except between a number and its associated multiplier or unit.

d) Terminators

Table 8 summarizes the terminator characters for both the IEEE-488 and the RS-232 remote interfaces.

Terminator Function	ASCII	Character	Control	Language Command	
Terminator Function	Number Control		Command Terminator	Terminator	
Carriage Return (CR)	13	Chr(13)	<cntl> M</cntl>	\ n	
Line Feed (LF)	10	Chr(10)	<cntl> J</cntl>	\ r	
Backspace (BS)	8	Chr(8)	<cntl> H</cntl>	\ b	
Form Feed (FF)	12	Chr(12)	<cntl> L</cntl>	\ f	
Examples: RS-232 Mode, terminal: RS-232 Mode, program: IEEE-488 Mode:	nal: OUT 1 V <enter></enter>				

#### **Table 8 - Terminator Characters**

#### IEEE-488 interface:

The CED 7000 sends the ASCII character Carriage Return with the EOI control line held high as the terminator for response messages. The CED 7000 recognizes the following as terminators when encountered in incoming data:

- ASCII CR character
- · Any ASCII character sent with the EOI control line asserted

#### RS-232 interface:

The CED 7000 sends a Carriage Return (CR) character as the terminator for response messages. The CED 7000 recognizes the following as terminators when encountered in incoming data:

- ASCII CR character
- ASCII LF character
- e) Incoming Character Processing

The CED 7000 processes all incoming data as follows:

- The most significant data bit (DIO8) is ignored
- All data is taken as 7-bit ASCII
- Lower case or upper case characters are accepted, with lower case converted to upper case before processing
- f) Response Message Syntax

In the detailed command descriptions in section 10, the responses from the CED 7000 are described wherever appropriate. In order to know what type of data to read in, refer to the beginning of the response description for the command.

### 9.7 Checking CED 7000 Status

Figure 33 shows the status registers, enable registers, and queues in the CED 7000 which indicate various conditions in the instrument. Some registers and queues are defined by the IEEE-488.2 standard, while the rest are specific to the CED 7000. In addition to the status registers, the Service Request (SRQ) control line and a 16-element buffer called the Error Queue provide also status information.

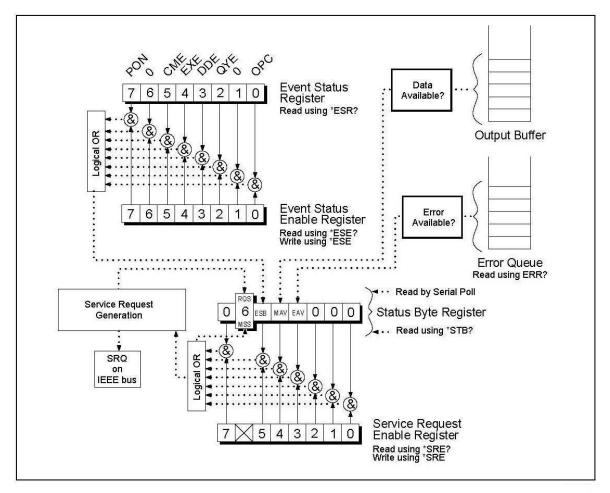


Figure 33 - Status Register Overview

Table 9 lists the status registers and gives the read/write commands and associated mask registers used to access them.

Status Register	Read Command	Write Command
Serial Poll Status Byte (STB)	*STB?	_
Service Request Enable Register (SRE)	*SRE?	*SRE
Event Status Register (ESR)	*ESR?	
Event Status Enable Register (ESE)	*ESE?	*ESE

### Table 9 - Status Register Summary

Each status register and queue has a summary bit in the Serial Poll Status Byte. Enable registers are used to mask various bits in the status registers and to generate summary bits in the Serial Poll Status Byte. For IEEE-488 interface operation, the Service Request Enable Register is used to assert the SRQ control line on detection of any status condition or conditions that the programmer chooses. For RS-232 interface operation, the SRQSTR string is sent over the serial interface when the SRQ line is set.

1) Serial Poll Status Byte (STB)

The Calibrator sends the serial poll status byte (STB) when it responds to a serial poll. This byte is cleared (set to 0) when the power is turned on. The STB byte structure is shown in Figure 34. Refer to the \*STB? command in section 10 for more information on reading this register.

7	6	5	4	3	2	1	0
0	RQS MSS	ESB	MAV	EAV	0	0	0
RQS	change f asserts t	rom 0 to 1 ar he SRQ cont	The RQS bit is s nd are enabled ( rol line on the IE he CED 7000 is	1) in the SRE	. When RQS face. You car	is 1, the CED	7000
MSS	enabled	Master summary status. Set to 1 whenever bits ESB, MAV, EAV, or ISCB are 1 and enabled (1) in the SRE. This bit can be read using the *STB? Remote command in place of doing a serial poll.					
ESB	Set to 1	when one or	more ESR bits a	are 1.			
MAV			The MAV bit is s face output buf		ver data is av	ailable in the (	CED
EAV			rror has occurre the FAULT? que		r is available t	o be read fror	n the

### Figure 34 - Serial Poll Status Byte (STB) and Service Request Enable (SRE) Registers

2) Service Request (SRQ) Line

IEEE-488 Service Request (SRQ) is an IEEE-488.1 bus control line that the CED 7000 asserts to notify the controller that it requires some type of service. Many instruments can be on the bus, but they all share a single SRQ line. To determine which instrument set SRQ, the Controller normally does a serial poll of each instrument. The calibrator asserts SRQ whenever the RQS bit in its Serial Poll Status Byte is 1. This bit informs the controller that the CED 7000 was the source of the SRQ.

The CED 7000 clears SRQ and RQS whenever the controller/host performs a serial poll, sends \*CLS, or whenever the MSS bit is cleared. The MSS bit is cleared only when ESB and MAV are 0, or they are disabled by their associated enable bits in the SRE register being set to 0.

3) Service Request Enable Register (SRE)

The Service Request Enable Register (SRE) enables or masks the bits of the Serial Poll Status Byte. The SRE is cleared at power up. Refer to Figure 34 for the bit functions.

4) Programming the STB and SRE

By resetting (to 0) the bits in the SRE, you can mask (disable) associated bits in the serial poll

status byte. Bits set to 1 enable the associated bit in the serial poll status byte.

5) Event Status Register (ESR)

The Event Status Register is a two-byte register in which the higher eight bits are always 0, and the lower eight bits represent various conditions of the CED 7000. The ESR is cleared (set to 0) when the power is turned on, and every time it is read. Many of the remote commands require parameters. Improper use of parameters causes command errors to occur. When a command error occurs, bit CME (5) in the Event Status Register (ESR) goes to 1 (if enabled in ESE register), and the error is logged in the error queue.

6) Event Status Enable (ESE) Register

A mask register called the Event Status Enable register (ESE) allows the controller to enable or mask (disable) each bit in the ESR. When a bit in the ESE is 1, the corresponding bit in the ESR is enabled. When any enabled bit in the ESR is 1, the ESB bit in the Serial Poll Status Byte also goes to 1. The ESR bit stays 1 until the controller reads the ESR, does a device clear, a selected device clear, or sends the reset or \*CLS command to the CED 7000. The ESE is cleared (set to 0) when the power is turned on.

7) Bit Assignments for the ESR and ESE

The bits in the Event Status Register (ESR) and Event Status Enable register (ESE) are assigned as shown in Figure 35.

15	14	13	12	11	10	9	8
0	0	0	0	0	0	0	0
7	6	5	4	3	2	1	0
PON	0	CME	EXE	DDE	QYE	0	OPC
PON		on. This bit i e ESR was re		e power has t	been turned off	and on since	e the last
CME	incorre	ctly formed c	ommand and p can be used to	placed an erro	e CED 7000 en or code in the e odes from the	error queue.	The
EXE	comma for exa	Execution error. An error occurred when the CED 7000 tried to execute the last command and an error code was placed into the error queue. This could be caused, for example, by a parameter being out of range. The command FAULT? can be used to fetch error codes from the error queue, which is described in more detail below.					
DDE		Device-dependent error. An error related to a device-dependent command has occurred.					
QYE	availab	Query error. The CED 7000 was addressed to talk when no response data was available or appropriate, or when the controller failed to retrieve data from the output queue.					
OPC					o reception of a cept another m		nand have

### Figure 35 - Event Status Register (ESR) and Event Status Enable (ESE) Registers

8) Programming the ESR and ESE

To read the contents of the ESR, send the remote command, \*ESR?. The ESR is cleared (set to 0) every time it is read. To read the contents of the ESE, send the remote command, \*ESE?. The ESE is not cleared when it is read. When you read either register, the CED 7000 responds by sending a decimal number that when converted to binary represents bits 0 through 15.

9) Output Queue

The output queue is loaded whenever a query is processed, and holds up to 250 characters. The controller reads it with a statement such as a BASIC INPUT statement, removing what it reads from the queue. If the queue is empty, the CED 7000 does not respond to the INPUT statement from the controller. The Message Available (MAV) bit in the Serial Poll Status Byte is 1 if there is

something in the output queue, and 0 if the output queue is empty.

10) Error Queue

When a command error, execution error, or device-dependent error occurs, its error code is placed in the error queue where it can be read by the FAULT? command. Reading the first error with the FAULT? command removes that error from the queue. A response of 0 means the error queue is empty. The error queue is cleared when you turn off the power, and when you use the \*CLS (Clear Status) common command. The error queue contains up to 15 entries. If more than 15 errors occur, only the first 15 errors are kept in the queue. A 16th entry in the queue is always an "error queue overflow" error, and all later errors are discarded until the queue is at least partially read. The first errors are kept, because if many errors occur before the user can acknowledge and read them, the earliest errors are the most likely to point to the problem. The later errors are usually repetitions or consequences of the original problem.

11) Input Buffer Operation

As the CED 7000 receives each data byte from the controller, it places the byte in a portion of memory called the input buffer. The input buffer holds up to 250 data bytes and operates in a first in, first out fashion.

#### IEEE-488 interface:

The CED 7000 treats the IEEE-488 EOI control line as a separate data byte and inserts it into the input buffer if it is encountered as part of a message terminator. Input buffer operation is transparent to the program running on the controller. If the controller sends commands faster than the CED 7000 can process them, the input buffer fills to capacity. When the input buffer is full, the CED 7000 holds off the IEEE-488 bus with the NRFD (Not Ready For Data) handshake line. When the CED 7000 has processed a data byte from the full input buffer, it then completes the handshake, allowing the controller to send another data byte. The calibrator clears the input buffer on power-up and on receiving the DCL (Device Clear) or SDC (Selected Device Clear) message from the controller.

#### RS-232 interface:

The CED 7000 uses the RS-232-C Xon/Xoff protocol to control buffer overflow. The CED 7000 sends a Xoff (Ctrl S) character when the input buffer becomes 80% full, and sends a Xon (Ctrl Q) character when it has processed enough of the input buffer so that it is less than 40% full.

# 10. Remote Commands

### **10.1 Introduction**

Remote commands duplicate actions that can be initiated from the front panel in local operating mode. Following the summary table is a complete alphabetical listing of all commands complete with protocol details. Separate headings in the alphabetical listing provide the parameters and responses, plus an example for each command. For information on using the commands, see section 9.

### **10.2 Command Summary by Function**

Command	Description
*CLS	Clear status. Clears the ESR, the error queue, and the RQS bit in the status byte. This command terminates any pending operation complete commands, *OPC or *OPC?.
*ESE	Loads a byte into the Event Status Enable register.
*ESE?	Returns the contents of the Event Status Enable register.
*ESR?	Returns the contents of the Event Status register and clears the register.
*IDN?	Identification query. Returns the manufacturer, model number, serial number, and firmware revision level of the Calibrator.
*OPC	Sets bit 0 (OPC for Operation Complete) in the Event Status Register to 1 when all pending device operations are complete.
*OPC?	Returns a 1 after all pending operations are complete. This command causes program execution to pause until all operations are complete. See also the *WAI command.
*OPT?	Returns a list of the installed hardware and software options.
*RST	Resets the state of the instrument to the power-up state. This command holds off execution of subsequent commands until it is complete.
*SRE	Loads a byte into the Service Request Enable register (SRE).
*SRE?	Returns the byte from the Service Request Enable register.
*STB?	Returns the status byte.
*TST?	Runs a series of self-tests and returns a "1" for pass or a "0" for fail. If any faults are detected, they are logged into the fault queue where they can be read by the FAULT? query.
*WAI	Prevents further remote commands from being executed until all previous remote commands have been completed.

### External Connection Commands

Command	Description
FUNC?	Returns the present output, measurement, or calibration function selected on the isolated and primary displays, in that order.
HART?	Returns the HART resistor setting for the isolated milliamp range, ON or OFF.
HART_OFF	Turns off the HART resistor on the isolated milliamp range.
HART_ON	Turns on the HART resistor on the isolated milliamp range.
ISO_PRES_UNIT	Sets the isolated display pressure units.
ISO_PRES_UNIT?	Returns the isolated display pressure units.
LOOP_POWER?	Returns the 24V loop power setting for the isolated milliamp range, ON or OFF.
LOOP_POWER _OFF	Turns off the 24V loop power on the isolated milliamp range.
LOOP_POWER _ON	Turns on the 24V loop power on the isolated milliamp range.
PRES_UNIT	Sets the primary display pressure units.
PRES_UNIT?	Returns the primary display pressure units.
RTD_TYPE	Sets the Resistance Temperature Detector (RTD) type.
RTD_TYPE?	Returns the Resistance Temperature Detector (RTD) type.
TC_REF	Selects the internal temperature sensor or an external reference value for cold junction compensation of thermocouple (TC) source and measurement.

TC_REF?	Returns the source of the temperature being used for cold junction compensation of thermocouple (TC) source and measurement.
TC_TYPE	Sets the thermocouple (TC) type.
TC_TYPE?	Returns the thermocouple (TC) type.
TSENS_TYPE	Sets temperature mode, RTD or TC.
TSENS_TYPE?	Returns the temperature mode.

## **Output Commands**

Command	Description
OPER	Activates the CED 7000 output if it is in standby mode.
OPER?	Returns the operate/standby mode setting.
OUT	Sets the output of the CED 7000.
OUT?	Returns the present output value of the CED 7000.
RANGE?	Returns the present output range, for voltage and current only.
RANGELCK	Locks the present output range, for voltage only.
RANGELCK?	Returns the RANGELOCK state, for voltage only.
STBY	Deactivates the CED 7000 output if it is in operate mode.

### Measurement Commands

Command	Description
ISO_MEAS	Sets the isolated input measurement type.
PRES?	Queries the attached pressure module for its manufacturer and serial number.
PRES_MEAS	Changes the operating mode of the primary display to pressure measurement.
RTD_MEAS	Changes the operating mode to RTD measurement.
TC_MEAS	Changes the operating mode to thermocouple measurement.
VAL?	Returns the last values for the isolated and primary measurements, in that order.
ZERO_MEAS	Zeros the pressure module, TC mV, or RTD ohms.
ZERO_MEAS?	Returns the zero offset for the pressure module, TC mV, or RTD ohms.

### **RS-232 Operating Mode Commands**

Command	Description
LOCAL	Puts the CED 7000 into the local state and disables lockout.
	Puts the CED 7000 into the lockout state. This command duplicates the IEEE-488 LLO (Local Lockout) message.
REMOTE	Puts the CED 7000 into the remote state. This command duplicates the IEEE-488 REN (Remote Enable) message.

### Status Commands

Command	Description	
FAULT?	Returns the most recent error code in the CED 7000 error queue, and then removes that error code from the queue.	

Error Number	Message Class	Description
1	DDE	Error queue overflow.
100	EXE	OPER or STBY was received when the CED 7000 is in measure mode or thermocouple source mode.
101	CME	A non-numeric entry was received in a field that should contain a numeric entry.
102	EXE	The numeric field exceeds 10 characters.
103	CME	Invalid units name or prefix.
104	EXE	An attempt to enter RTD source mode was made when SPRT is selected, or to select SPRT when RTD source mode is selected.
105	EXE	Entry is above upper limit for the selected output range.
106	EXE	Entry is below lower limit for the selected output range.
108	CME	A required command parameter was missing.
109	CME	An invalid TC_MEAS or RTD_MEAS unit parameter (not CEL or FAR) was received, or an invalid PRES_UNIT or ISO_PRES_UNIT parameter was received.
110	CME	An invalid RANGELCK parameter was received.
111	EXE	RANGELCK ON was received when the CED 7000 is not in Volts mode.
112	CME	An invalid RTD_TYPE parameter was received.
113	CME	An invalid TC_REF parameter was received.
114	CME	An invalid TSENS_TYPE parameter was received.
116	EXE	No pressure module was present when a pressure function was requested, or the total zero offset from calibration is more than 6%. This error can also occur if the total zero offset from calibration is out of limits when zeroing the thermocouple millivolts type (maximum offset $\pm 1$ mV), or the RTD ohms type (maximum $\pm 0.1$ ohm on high range, or $\pm 0.01$ ohm on the low range).
117	CME	An unrecognizable command was received.
118	CME	An invalid parameter was received.
120	EXE	The serial input buffer overflowed
121	EXE	The command string buffer overflowed.
122	QYE	The serial output buffer overflowed.
123	DDE	The output overloaded. See display error message OVER LOAD in section 2.7.
124	DDE	The CED 7000 is out of tolerance. This error is set after a failed initialization or a failed *TST? command.
125	DDE	The CED 7000 ADC has failed. This error is set after a failed initialization or a failed *TST? command.

# 10.3 Error Code Listing

### 10.4 Remote Command Listing

The following is an alphabetical list of all CED 7000 remote commands and queries, including the common commands and the device-dependent commands. Each command title includes a checkbox that indicates the remote interface applicability, IEEE-488 and/or RS-232, and the command group, Sequential or Overlapped; see section 9.6.1 for a description of these terms.

*CLS	🛛 IEEE-488 🖾 RS-232 🖾 Sequential 🗌 Overlapped	
Clear Status command. This command clears the ESR, the error queue, and the RQS bit in the status byte. This command terminates any pending operation complete commands, *OPC or *OPC?.		
Parameter:	<none></none>	
Response:	<none></none>	
Example:	*CLS	
	This example clears the ESR, the error queue, and the RQS bit in the status byte.	
*ESE	🛛 IEEE-488 🖾 RS-232 🖾 Sequential 🗌 Overlapped	
	ble command. This command loads a byte into the Event Status Enable (ESE) Event Status Enable Register (ESE) description in section 9.7.	
Parameter:	<value></value>	
D	where <value> is the decimal equivalent of the ESE byte, 0 to 255</value>	
Response:	<none></none>	
Example:	*ESE 140	
	This example loads decimal 140 (binary 10001100) to enable bits 7 (PON), 3 (DDE) and 2 (QYE).	
*ESE?	XIEEE-488 XRS-232 XSequential Overlapped	
	ble query. This command returns the contents of the Event Status Enable (ESE) Event Status Enable Register (ESE) description in section 9.7.	
Parameter:	<none></none>	
Response:	<value></value>	
	where <value> is the decimal equivalent of the ESE byte, 0 to 255</value>	
Example:	*ESE?	
	133	
	This example returns decimal 133 (binary 10000101) which indicates that bits 7 (PON), 2 (QYE), 1 (OPC) are enabled.	
*ESR?	XIEEE-488 XRS-232 XSequential Overlapped	
	ster query. This command returns the contents of the Event Status Register (ESR) ister. See the Event Status Register (ESR) description in section 9.7.	
Parameter:	<none></none>	
Response:	<value> where <value> is the decimal equivalent of the ESR byte, 0 to 255</value></value>	
Example:	*ESR?	
	61	
	This example returns decimal 61 (binary 00111101) which indicates that bits 5 (CME), 4 (EXE), 3 (DDE), 2 (QYE) and 0 (OPC) are enabled.	

FAULT?	XIEEE-488 XRS-232 Sequential Overlapped
errors have occurr	urns the most recent error code from the error queue. If the queue is empty (no ed) it returns 0. The command is normally used to verify that the previous t it was intended to do.
Parameter:	<none></none>
Response:	<value> where <value> is one of the error codes documented in section 10.3.</value></value>
Example:	FAULT?
	105
	This example shows the error code which would occur if the previous command attempted to set a value above 100 mA for current output. The error code 105 indicates that the value was above the upper limit for the selected output range.
FUNC?	IEEE-488 XRS-232 Sequential Overlapped
This command retrisolated displays.	urns the present output, measurement, or calibration function for the primary and
Parameter:	<none></none>
Response:	<isolated>,<primary> where <isolated> is one of the following:</isolated></primary></isolated>
	DC10Vmeasure DC voltage, 10V rangeDC100Vmeasure DC voltage, 100V rangeDCImeasure DC currentPRESSUREmeasure pressure
	and where <primary> is one of the following:</primary>
	DCVsource DC voltageDCIsource DC currentRTD_OUTsource RTD/OhmsRTD_INmeasure RTD/OhmsTC_OUTsource thermocoupleTC_INmeasure thermocouplePRESSUREmeasure pressure
Example:	FUNC?
	DC10V,PRESSURE
	This example indicates that the isolated display is selected to the 10V range and the primary display is selected to pressure.
HART?	XIEEE-488 XRS-232 Sequential Overlapped
This command ret	urns the isolated DC current input HART resistor status.
Parameter:	<none></none>
Response:	<value> where <value> is ON or OFF</value></value>
Example:	HART?
	OFF
	This example indicates that the isolated DC current input HART resistor is turned off.

HART_OFF	IEEE-488 IRS-232 ISequential Overlapped
This command dis	sables the isolated DC current input HART resistor.
Parameter:	<none></none>
Response:	<none></none>
Example:	HART_OFF
	This example disables the isolated DC current input HART resistor.
HART_ON	IEEE-488 XRS-232 Sequential Overlapped
This command en	ables the isolated DC current input HART resistor.
Parameter:	<none></none>
Response:	<none></none>
Example:	HART_ON
	This example enables the isolated DC current input HART resistor.
*IDN?	XIEEE-488 XRS-232 XSequential Overlapped
This command re and firmware revis	eturns the unit identification: instrument manufacturer, model number, serial number, sion level.
Parameter:	<none></none>
Response:	<text string=""> where <text string=""> contains the following four fields separated by commas: 1. Manufacturer 2. Model number 3. Serial number (always 0) 4. Firmware revision level</text></text>
Example:	*IDN?
	WIKA, CED 7000,0,1.2
	This example indicates the manufacturer is WIKA, the model is CED 7000, the serial number is 0, and the firmware version is 1.2.
ISO_MEAS	XIEEE-488 XRS-232 Sequential Overlapped
This command se	ts the isolated measurement type.
Parameter:	<value></value>
	where <value> is one of the following:DC10Vmeasure DC voltage, 10V rangeDC100Vmeasure DC voltage, 100V rangeDCImeasure DC currentPRESSUREmeasure pressure</value>
Response:	<none></none>
Example:	ISO_MEAS DCI
	This example sets the isolated measurement to DC current.

100 BBEC :::::	
	ets the isolated pressure unit.
Parameter:	<value> where <value> is one of the following:</value></value>
	PSI pounds per square inch
	INH2O4C inches of water at 4 °C
	INH2O20C inches of water at 20 °C
	INH2O60F inches of water at 60 °F CMH2O4C centimeters of water at 4 °C
	CMH2O20C centimeters of water at 20 °C
	MMH2O4C millimeters of water at 4 °C
	MMH2O20C millimeters of water at 20 °C
	BAR bars
	MBAR millibars KPA kilopascals
	MPA megapascals
	INHG inches of mercury at 0 °C
	MMHG millimeters of mercury at 0 °C
_	KG/CM2 kilograms per square centimeter
Response:	
Example:	ISO_PRES_UNIT BAR
	This example sets the isolated pressure unit to bars.
ISO_PRES_UNIT	<b>7?</b> XIEEE-488 XRS-232 XSequential Overlapped
This command re	turns the isolated pressure unit.
Parameter:	<none></none>
Response:	<value></value>
	where <value> is one of the following:</value>
	PSI pounds per square inch INH2O4C inches of water at 4 °C
	INH2020C inches of water at 20 °C
	INH2O60F inches of water at 60 °F
	CMH2O4C centimeters of water at 4 °C
	CMH2O20C centimeters of water at 20 °C MMH2O4C millimeters of water at 4 °C
	MMH2O4C millimeters of water at 4 °C MMH2O20C millimeters of water at 20 °C
	BAR bars
	MBAR millibars
	KPA kilopascals
	MPA megapascals INHG inches of mercury at 0 °C
	MMHG millimeters of mercury at 0 °C
	KG/CM2 kilograms per square centimeter
Example:	ISO_PRES_UNIT?
	BAR
	This example indicates that the isolated pressure unit is bars.
LOCAL	IEEE-488 X RS-232 X Sequential Overlapped
	uts the CED 7000 into the local state, clearing the remote state (see the REMOTE
	e front panel lockout state (see the LOCKOUT command). It duplicates setting the
Parameter:	<none></none>
Response:	<none></none>
Example:	LOCAL
front panel lockou	This example puts the instrument into the local state, clearing the remote state and it state, if enabled.

LOCKOUT	IEEE-488 XRS-232 Sequential Overlapped
command). In t	puts the CED 7000 into the lockout state when in remote control (see the REMOTE his state, no local operation is allowed at the front panel, including the LOCAL key. To t condition, use the LOCAL command. This command duplicates the IEEE-488 LLO message.
Parameter:	<none></none>
Response:	<none></none>
Example:	LOCKOUT
	This example puts the instrument into the lockout state. No front panel controls can be used.
	R? XIEEE-488 XRS-232 Sequential Overlapped
This command	returns the isolated DC current input 24V loop power status.
Parameter:	<none></none>
Response:	<value> where <value> is ON or OFF</value></value>
Example:	LOOP_POWER?
	OFF
	This example indicates that the isolated DC current input 24V loop power is turned off.
	R_OFF XIEEE-488 XRS-232 XSequential Overlapped
This command	disables the isolated DC current input $24V$ loop power.
Parameter:	<none></none>
Response:	<none></none>

r arameter.	
Response:	<none></none>
Example:	LOOP_POWER_OFF
	This example disables the isolated DC current input 24V loop power.

This command en	ables the isolated DC current input $24V$ loop power.
Parameter:	<none></none>
Response:	<none></none>
Example:	LOOP_POWER_ON
	This example enables the isolated DC current input 24V loop power.

\*OPC XIEEE-488 XRS-232 Sequential Overlapped

LOOP\_POWER\_ON

Operations Complete command. This command sets bit 0 (OPC) of the Event Status Register to 1 when all pending device operations are complete. Also see the \*ESR? command.

XIEEE-488 XRS-232 Sequential Overlapped

Parameter:	<none></none>
Response:	<none></none>
Example:	*OPC
	This example sets bit 0 of the Event Status Register to 1 when all pending device operations are done.

*OPC? 🛛 IEE	E-488 🛛 RS-232 🛛 Sequential 🗌 Overlapped
complete. This co	lete query. This command returns a 1 after all pending CED 7000 operations are ommand does not respond until all pending CED 7000 operations are complete, of program execution to pause until operations are complete. Also see the *WAI
Parameter:	<none></none>
Response:	1
Example:	*OPC?
	1
	This example does not respond until all pending CED 7000 operations are complete, and then returns 1.
	-488 XRS-232 Sequential XOverlapped
	aces the CED 7000 in operate mode, activating the output at front panel terminals. tts the same as pressing the front panel key when in standby mode.
Parameter:	<none></none>
Response:	<none></none>
Example:	OPER
	This example connects the selected output to the CED 7000 front panel terminals. It also indicates Opr on the display.
OPER?	🛛 IEEE-488 🖾 RS-232 🖾 Sequential 📋 Overlapped
This command re	turns the present operate/standby mode setting.
Parameter:	<none></none>
Response:	<value></value>
	where <value> is "1" for operate mode and "0" for standby mode</value>
Example:	OPER?
	1
	This example indicates that the CED 7000 is in operate mode.
* <b>OPT?</b> This command re reserved for future	IEEE-488 XRS-232 Sequential Overlapped turns a list of the installed hardware and software options. This command is e use.
Parameter:	<none></none>
Response: where <text string<="" td=""><td><text string=""> &gt; is "0" if no options are installed, or a list of installed options separated by commas</text></td></text>	<text string=""> &gt; is "0" if no options are installed, or a list of installed options separated by commas</text>
Example:	*OPT?
	0
	The example indicates that no options are installed.

the desired mode commands. Use	ets the output mod and sensor paran the multiplier prefi	-488 XRS-232 Sequential Overlapped le and value of the CED 7000. To source a temperature, select neters first with the TSENS_TYPE, RTD_TYPE, and TC_TYPE xes k for kilo, m for milli, and u for micro with the OUT command omitted if the output mode is not to be changed.
Parameter:	<value> <units></units></value>	
		is the output value to be generated
	u) as described	s> is one of the following, with a possible prefix multiplier (k, m, or above:
	V	DC volts
	A OHM	DC current Resistance
	CEL	Temperature in Celsius
	FAR	Temperature in fahrenheit
Response:	<none></none>	
Examples:		Explanation
	OUT 15.2 V OUT 1.2 mA	Change to DC volts, output 15.2 V Change to DC current, output 1.2 mA, note units prefix multiplier
		m
	OUT 5 Ohm	Change to Resistance, output 5 O
	OUT 100 CEL OUT 3	Change to temperature in °C, output 100 °C No change to output mode, output a value of 3 in the present
	0010	units
OUT?		E-488 XRS-232 X Sequential Overlapped
		E-488 X RS-232 X Sequential Overlapped
		E-488 X RS-232 X Sequential Overlapped Output value and units of the CED 7000.
This command re	turns the present of	output value and units of the CED 7000.
This command re Parameter:	turns the present ( <none> <value>,<units></units></value></none>	output value and units of the CED 7000.
This command re Parameter:	turns the present of <none> <value>,<units> where <value> and where <unit< td=""><td>output value and units of the CED 7000. is the present output value is&gt; is one of the following:</td></unit<></value></units></value></none>	output value and units of the CED 7000. is the present output value is> is one of the following:
This command re Parameter:	turns the present ( <none> <value>,<units> where <value></value></units></value></none>	output value and units of the CED 7000. is the present output value
This command re Parameter:	turns the present of <none> <value>,<units> where <value> and where <unit V A OHM</unit </value></units></value></none>	is the present output value is> is one of the following: DC volts DC current Resistance
This command re Parameter:	turns the present of <none> <value>,<units> where <value> and where <unit V A OHM CEL</unit </value></units></value></none>	output value and units of the CED 7000. is the present output value is> is one of the following: DC volts DC current Resistance Temperature in Celsius
This command re Parameter:	turns the present of <none> <value>,<units> where <value> and where <unit V A OHM</unit </value></units></value></none>	is the present output value is> is one of the following: DC volts DC current Resistance
This command re Parameter:	turns the present of <none> <value>,<units> where <value> and where <unit V A OHM CEL</unit </value></units></value></none>	output value and units of the CED 7000. is the present output value is> is one of the following: DC volts DC current Resistance Temperature in Celsius Temperature in fahrenheit
This command re Parameter: Response:	turns the present of <none> <value>,<units> where <value> and where <unit V A OHM CEL FAR Explana OUT?</unit </value></units></value></none>	output value and units of the CED 7000. is the present output value is> is one of the following: DC volts DC current Resistance Temperature in Celsius Temperature in fahrenheit ation
This command re Parameter: Response:	turns the present of <none> <value>,<units> where <value> and where <unit V A OHM CEL FAR Explana OUT? 1.88300E-02,A</unit </value></units></value></none>	output value and units of the CED 7000. is the present output value is> is one of the following: DC volts DC current Resistance Temperature in Celsius Temperature in fahrenheit
This command re Parameter: Response:	turns the present of <none> <value>,<units> where <value> and where <unit V A OHM CEL FAR Explana OUT? 1.88300E-02,A OUT?</unit </value></units></value></none>	output value and units of the CED 7000. is the present output value ts> is one of the following: DC volts DC current Resistance Temperature in Celsius Temperature in fahrenheit ation Present output is 18.83 mA
This command re Parameter: Response:	turns the present of <none> <value>,<units> where <value> and where <unit V A OHM CEL FAR Explana OUT? 1.88300E-02,A OUT? 1.23000E+00,V</unit </value></units></value></none>	output value and units of the CED 7000. is the present output value is> is one of the following: DC volts DC current Resistance Temperature in Celsius Temperature in fahrenheit ation
This command re Parameter: Response:	turns the present of <none> <value>,<units> where <value> and where <unit V A OHM CEL FAR Explana OUT? 1.88300E-02,A OUT?</unit </value></units></value></none>	output value and units of the CED 7000. is the present output value is> is one of the following: DC volts DC current Resistance Temperature in Celsius Temperature in fahrenheit ation Present output is 18.83 mA Present output is 1.23 V
This command re Parameter: Response:	value>, <units> <value>,<units> where <value> and where <unit V A OHM CEL FAR Explana OUT? 1.88300E-02,A OUT? 1.23000E+00,V OUT?</unit </value></units></value></units>	output value and units of the CED 7000. is the present output value ts> is one of the following: DC volts DC current Resistance Temperature in Celsius Temperature in fahrenheit ation Present output is 18.83 mA Present output is 1.23 V HM Present output is 4.0 KO

PRES?	IEEE-488 XRS-232 Sequential Overlapped
This command qu firmware version.	ueries the attached pressure module for its manufacturer, serial number, and
Parameter:	<none></none>
Response:	<text string=""> where <text string=""> contains the following three fields separated by commas: 1. Manufacturer 2. Serial number 3. Firmware revision level (always 0)</text></text>
PRES_MEAS	XIEEE-488 RS-232 Sequential Overlapped
This command ch	nanges the primary display operating mode to pressure measurement.
Parameter:	<none></none>
Response:	<none></none>
Example:	PRES_MEAS
	This example changes the primary display operating mode to pressure measurement.
PRES_UNIT	🛛 IEEE-488 🛛 RS-232 📋 Sequential 🛛 Overlapped
This command se	ets the primary display pressure units.
Parameter:	<value></value>
	where <value> is one of the following:</value>
	PSIpounds per square inchINH2O4Cinches of water at 4 °CINH2O20Cinches of water at 20 °CINH2O60Finches of water at 60 °FCMH2O4Ccentimeters of water at 4 °CCMH2O20Ccentimeters of water at 20 °CMMH2O4Cmillimeters of water at 4 °CMMH2O20Cmillimeters of water at 20 °CBARbarsMBARmillibarsKPAkilopascalsINHGinches of mercury at 0 °CMMHGmillimeters of mercury at 0 °CKG/CM2kilograms per square centimeter
Response:	<none></none>
Example:	PRES_UNIT BAR
	This example sets the primary display pressure units to bars.

PRES_UNIT?	XIEEE-488 XRS-232 Sequential Overlapped
This command ret	urns the primary display pressure units.
Parameter:	<none></none>
Response:	<value></value>
	where <value> is one of the following:</value>
	PSIpounds per square inchINH2O4Cinches of water at 4 °CINH2O20Cinches of water at 20 °CINH2O60Finches of water at 60 °FCMH2O4Ccentimeters of water at 4 °CCMH2O20Ccentimeters of water at 20 °CMMH2O4Cmillimeters of water at 20 °CMMH2O4Cmillimeters of water at 20 °CMMH2O20Cmillimeters of water at 20 °CBARbarsMBARmillibarsKPAkilopascalsMPAmegapascalsINHGinches of mercury at 0 °C
	MMHG millimeters of mercury at 0 °C
	KG/CM2 kilograms per square centimeter
Example:	PRES_UNIT?
	BAR
	This example indicates that the primary pressure display units are bars
RANGE?	XIEEE-488 XRS-232 Sequential Overlapped
This command ret	urns the present DC voltage or current output range.
Parameter:	<none></none>
Response:	<value></value>
	where <value> is one of the following:</value>
	V_0.1V DC volts, 100 mV range V_1V DC volts, 1V range
	V_10V DC volts, 10 V range
	V_100V DC volts, 100 V range
	A_0.1A DC current
	NONE neither volts nor current is selected
Example:	RANGE?
	V_10V
	This example indicates that the present output range is 10 V.
RANGELCK	XIEEE-488 XRS-232 Sequential Overlapped
	ks or unlocks the DC voltage output range per the present output value.
Parameter:	<value></value>
	where <value> is one of the following:</value>
	ON to lock the present voltage range
D	OFF to unlock the present voltage range
Response:	<none></none>
Example:	RANGELCK ON
	If the present DC voltage output is 5 V, this example locks the range at 10 VDC.

Parameter: <none>         Response:       <value>         where <value> is one of the following:         ON       DC voltage range lock is on         OFF       DC voltage range lock is off         Example:       RANGELCK?         OFF       This example indicates that the range lock is off.         REMOTE       □IEEE-488 ☑ RS-232 ☑ Sequential □Overlapped         This command places the CED 7000 into the remote state. It duplicates the IEEE-488 REN (Remote Enable) message. When the CED 7000 is in the remote state, but not locked out, only the LOCAL key is active. If the front panel is also locked out, no front panel keys are active; see the LOCKOUT command. To unlock the front panel, use the LOCAL command, or cycle the CED 7000 power switch.         Parameter:       <none>         Response:       <none>         Example:       REMOTE         This example places the CED 7000 into the remote state.</none></none></value></value></none>	I his command	IEEE-488 XRS-232 Sequential Overlapped
where <value> is one of the following:         ON       DC voltage range lock is on         OFF       DC voltage range lock is off         Example:       RANGELCK?         OFF       This example indicates that the range lock is off.         REMOTE       IEEE-488       RS-232       Sequential       Overlapped         This command places the CED 7000 into the remote state. It duplicates the IEEE-488 REN (Remot         Enable) message.       When the CED 7000 is in the remote state, but not locked out, only the LOCAL         key is active.       If the front panel is also locked out, no front panel keys are active; see the LOCKOUT         command.       To unlock the front panel, use the LOCAL command, or cycle the CED 7000 power         switch.       Parameter:       <none>         Response:       <none>         Example:       REMOTE         This example places the CED 7000 into the remote state.         *RST       IEEE-488       RS-232         Sequential       Overlapped         This command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.</none></none></value>	Parameter:	
OFF       DC voltage range lock is off         Example:       RANGELCK? OFF This example indicates that the range lock is off. <b>REMOTE</b> IEEE-488       RS-232       Sequential       Overlapped         This command places the CED 7000 into the remote state. It duplicates the IEEE-488 REN (Remot Enable) message. When the CED 7000 is in the remote state, but not locked out, only the LOCAL key is active. If the front panel is also locked out, no front panel keys are active; see the LOCKOUT command. To unlock the front panel, use the LOCAL command, or cycle the CED 7000 power switch.         Parameter: <none>         Response:       <none>         Example:       REMOTE This example places the CED 7000 into the remote state.         *<b>RST</b>       IEEE-488       RS-232       Sequential         *<b>RST</b>       IEEE-488       RS-232       Sequential         This command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.</none></none>	Response:	
OFF         This example indicates that the range lock is off. <b>REMOTE</b> IEEE-488       RS-232       Sequential       Overlapped         This command places the CED 7000 into the remote state. It duplicates the IEEE-488 REN (Remote Enable) message. When the CED 7000 is in the remote state, but not locked out, only the LOCAL key is active. If the front panel is also locked out, no front panel keys are active; see the LOCKOUT command. To unlock the front panel, use the LOCAL command, or cycle the CED 7000 power switch.         Parameter: <none>         Response:       <none>         Example:       REMOTE         This example places the CED 7000 into the remote state.         *<b>RST</b>       IEEE-488         Response:       <none>         Framework in the command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.</none></none></none>		
REMOTE       IEEE-488       RS-232       Sequential       Overlapped         This command places the CED 7000 into the remote state. It duplicates the IEEE-488 REN (Remot Enable) message. When the CED 7000 is in the remote state, but not locked out, only the LOCAL key is active. If the front panel is also locked out, no front panel keys are active; see the LOCKOUT command. To unlock the front panel, use the LOCAL command, or cycle the CED 7000 power switch.         Parameter: <none>         Response:       <none>         Example:       REMOTE This example places the CED 7000 into the remote state.         *RST       IEEE-488       RS-232       Sequential         This command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.</none></none>	Example:	
This command places the CED 7000 into the remote state. It duplicates the IEEE-488 REN (Remote Enable) message. When the CED 7000 is in the remote state, but not locked out, only the LOCAL key is active. If the front panel is also locked out, no front panel keys are active; see the LOCKOUT command. To unlock the front panel, use the LOCAL command, or cycle the CED 7000 power switch.         Parameter: <none>         Response:       <none>         Example:       REMOTE         This example places the CED 7000 into the remote state.         *RST       IEEE-488         X       RS-232         Sequential       Overlapped         This command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.</none></none>		This example indicates that the range lock is off.
This command places the CED 7000 into the remote state. It duplicates the IEEE-488 REN (Remote Enable) message. When the CED 7000 is in the remote state, but not locked out, only the LOCAL key is active. If the front panel is also locked out, no front panel keys are active; see the LOCKOUT command. To unlock the front panel, use the LOCAL command, or cycle the CED 7000 power switch.         Parameter: <none>         Response:       <none>         Example:       REMOTE         This example places the CED 7000 into the remote state.         *RST       IEEE-488         X       RS-232         Sequential       Overlapped         This command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.</none></none>	REMOTE	IEEE-488 XRS-232 X Sequential Overlapped
Response: <none>         Example:       REMOTE         This example places the CED 7000 into the remote state.         *RST       IEEE-488         X       RS-232         Sequential       Overlapped         This command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.</none>	key is active. If	f the front panel is also locked out, no front panel keys are active; see the LOCKOUT
Example:       REMOTE This example places the CED 7000 into the remote state.         *RST       IEEE-488       RS-232       Sequential       Overlapped         This command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.	switch.	
*RST       X IEEE-488       X RS-232       Sequential       X Overlapped         This command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.	switch.	
*RST X IEEE-488 X RS-232 Sequential X Overlapped This command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.	switch.	<none></none>
This command resets the CED 7000 to the power-up state and holds off execution of subsequent commands until the reset operation is complete.	switch. Parameter:	<none></none>
commands until the reset operation is complete.	switch. Parameter: Response:	<none> <none> REMOTE</none></none>
A reset action invokes the following commands and values for the primary display:	switch. Parameter: Response:	<none> <none> REMOTE This example places the CED 7000 into the remote state.</none></none>
	switch. Parameter: Response: Example: * <b>RST</b> This command	<none> <none> REMOTE This example places the CED 7000 into the remote state. IEEE-488 XRS-232 Sequential X Overlapped I resets the CED 7000 to the power-up state and holds off execution of subsequent</none></none>
	switch. Parameter: Response: Example: *RST This command commands unt A reset action i	<none> <none> REMOTE This example places the CED 7000 into the remote state. IEEE-488 X RS-232 Sequential Overlapped I resets the CED 7000 to the power-up state and holds off execution of subsequent if the reset operation is complete.</none></none>

Command	value
OUT	0 V
PRES_UNIT	Last selected
RANGE	0.1 V
RTD_TYPE	Last selected
STBY	(No output)
TC_REF	INT
TC_TYPE	Last selected
TSENS_TYPE	Last selected

The isolated display and selections remain as they were last selected.

Parameter:	<none></none>
Response:	<none></none>
Example:	*RST
	This example resets the CED 7000, invoking the commands and values shown above.

RTD_MEAS	🛛 IEEE-488 🛛 RS-232 🖾 Sequential 📋 Overlapped
This command pla	aces the primary display in RTD measure mode.
Parameter:	<value></value>
	where <value> is one of the following:</value>
	CEL display in degrees celsius
	FAR display in degrees fahrenheit <none> display in the last selected temperature unit</none>
Response:	<none></none>
Example:	RTD_MEAS CEL
Example:	This example sets the CED 7000 to RTD measure mode, displaying in degrees
	celsius.
RTD_TYPE	🛛 IEEE-488 🖾 RS-232 📋 Sequential 🖾 Overlapped
TSENS_TYPE co OUT command, if	Ily, before using the RTD_TYPE command to select the RTD type, use the ommand to select RTD mode, and afterwards set the output temperature using the f applicable. A change in temperature sensors sets the output to 0 °C. Note that the e used to measure signals, not source them.
Parameters:	<value></value>
	where <value> is one of the following:</value>
	PT385_100       100-ohm RTD, curve a=0.00385 ohms/ohm/°C         PT385_200       200-ohm RTD, curve a=0.00385 ohms/ohm/°C         PT385_500       500-ohm RTD, curve a=0.00385 ohms/ohm/°C         PT385_1000       1000-ohm RTD, curve a=0.00385 ohms/ohm/°C         PT392_100       1000-ohm RTD, curve a=0.003926 ohms/ohm/°C         PTJIS_100       100-ohm RTD, curve a=0.003916 ohms/ohm/°C         PTJIS_100       100-ohm RTD, empirical curve         N1120       120-ohm RTD, empirical curve         YSI_400       YSI thermistor curve
	OHMS_HIGH 4000 ohms range OHMS_LOW 400 ohms range
	SPRT standard PRT with user defined error coefficients, only available for measurement
	USR_DEF <x> RTD with user defined custom coefficients, where x is the curve number and ranges from 1 to 5, i.e. USR_DEF2 for curve 2</x>
Response:	<none></none>
Example:	RTD_TYPE PTJIS_100
	This example sets the RTD sensor to a 100-ohm type, using the PT3916 curve (a= $0.003916$ ohms/ohm/°C). The resistance of 100 ohms refers to the ice point characteristic, the resistance of the RTD at 0 °C (32 °F).

**RTD TYPE?** X RS-232 X Sequential Overlapped X IEEE-488 This command returns the Resistance Temperature Detector (RTD) sensor type being used for RTD temperature source and measurement. Parameter: <None> Response: <value> where <value> is one of the following: PT385 100 100-ohm RTD, curve a=0.00385 ohms/ohm/°C PT385 200 200-ohm RTD, curve a=0.00385 ohms/ohm/°C 500-ohm RTD, curve a=0.00385 ohms/ohm/°C PT385 500 PT385\_1000 1000-ohm RTD, curve a=0.00385 ohms/ohm/°C PT392\_100 100-ohm RTD, curve a=0.003926 ohms/ohm/°C PTJIS\_100 100-ohm RTD, curve a=0.003916 ohms/ohm/°C CU10 10-ohm RTD, empirical curve 120-ohm RTD, empirical curve NI120 YSI 400 YSI thermistor curve OHMS\_HIGH 4000 ohms range OHMS LOW 400 ohms range SPRT standard PRT with user defined error coefficients, only available for measurement USR DEF<x> RTD with user defined custom coefficients, where x is the curve number and ranges from 1 to 5, i.e. USR DEF2 for curve 2 Example: RTD\_TYPE? PTJIS 100 This example indicates that the RTD sensor type is a 100-ohm RTD with curve a=0.3916 ohm/°C. XIEEE-488 XRS-232 XSequential ∏Overlapped \*SRE Service Request Enable command. This command loads a byte into the Service Request Enable (SRE) register. See the Service Request Enable Register (SRE) description in section 9.7. Since bit 6 is not used (decimal value 64), the maximum entry is 255 - 64 = 191. Parameter: <value> where <value> is the decimal equivalent of the SRE byte, 0 to 191 Response: <None> Example: \*SRE 48 This example enables bits 4 (MAV) and 5 (ESB). \*SRE? IEEE-488 IRS-232 ISequential ☐ Overlapped Service Request Enable query. This command returns the byte in the Service Request Enable Register (SRE). See the Service Request Enable Register (SRE) description in section 9.7. Parameter: <None> Response: <value> where <value> is the decimal equivalent of the SRE byte, 0 to 191 \*SRE? 48 Example: This example indicates that bits 4 (MAV), and 5 (ESB) are enabled. XIEEE-488 XRS-232 XSequential Overlapped \*STB? Status Byte Register query. This command returns the byte in the Status Byte Register. See the Status Byte Register (STB) description in section 9.7. <None> Parameter: Response: <value> where <value> is the decimal equivalent of the STB byte, 0 to 255 Example: \* STB? 96

This example indicates that bits 5 (ESB) and 6 (MSS) are set.

STBY	XIEEE-488 XRS-232 Sequential XOverlapped
	aces the CED 7000 in standby mode, deactivating the output at front panel $p_{\rm m}$ mmand acts the same as pressing the front panel key when in operate mode.
Parameter:	<none></none>
Response:	<none></none>
Example:	STBY
	This example disconnects the selected output from the CED 7000 front panel terminals. It also indicates Stby on the display.
TC_MEAS	XIEEE-488 XRS-232 XSequential Overlapped
This command pla	aces the primary display in thermocouple measure mode.
Parameter:	<value></value>
	where <value> is one of the following:</value>
	CEL display in degrees celsius
	FAR display in degrees fahrenheit <none> display in the last selected temperature unit</none>
Response:	<none></none>
Example:	TC MEAS FAR
Example.	This example sets the CED 7000 to thermocouple measure mode, displaying in
	degrees Fahrenheit.
	IEEE-488 XRS-232 Sequential Overlapped elects the internal temperature sensor or an external reference value for cold junction thermocouple source and measurement.
Parameter:	<value></value>
	where <value> is one of the following:</value>
	INT use internal temperature sensor
	EXT use external reference value Response: <none></none>
Example:	Response: <none> TC REF EXT</none>
Example.	—
	This example sets the thermocouple reference to external.
TC_REF?	XIEEE-488 XRS-232 Sequential Overlapped
	turns the source of the temperature being used for cold junction compensation of Irce and measurement.
Parameter:	<none></none>
Response:	<value></value>
·	where <value> is one of the following:</value>
	INT internal temperature sensor in use
	EXT external reference value in use
Example:	•
Example:	EXT external reference value in use
Example:	EXT external reference value in use TC_REF?

This command sets the Thermocouple (TC) sensor type being used for TC temperature source and measurement. Normally, before using the TC_TYPE command to select the TC type, use the TSENS_TYPE command to select TC mode, and afterwards set the output temperature using the OUT command, if applicable. A change in temperature sensors sets the output to 0 °C. Parameters:                  Where <value>       where <value> is one of the following:         B       B-type thermocouple         C       C-type thermocouple         J       J-type thermocouple         K       K-type thermocouple         L       L-type thermocouple         K       K-type thermocouple         R       R-type thermocouple         N       N-type thermocouple         R       R-type thermocouple         R       R-type thermocouple         R       R-type thermocouple         R       R-type thermocouple         T       T-type thermocouple         S       S-type thermocouple         Z       1         M       V-type thermocouple         R       R-type thermocouple         Z       1         D       U-type thermocouple         Z       1         M       N-type thermocouple         Z</value></value>		X IEE	E-488 XRS-232 Sequential XOverlapped
where <value> is one of the following:         B       B-type thermocouple         C       C-type thermocouple         E       E-type thermocouple         J       J-type thermocouple         L       L-type thermocouple         L       L-type thermocouple         R       R-type thermocouple         R       R-type thermocouple         S       S-type thermocouple         T       T-type thermocouple         U       U-type thermocouple         Z       1 mV/°C         Response:       <none>         Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       XIEEE-488 XRS-232 XSequential Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:       <none></none></none></value>	TSENS_TYPE co	ormally, before us mmand to select	sing the TC_TYPE command to select the TC type, use the TC mode, and afterwards set the output temperature using the
B       B-type thermocouple         C       C-type thermocouple         E       E-type thermocouple         J       J-type thermocouple         L       L-type thermocouple         N       N-type thermocouple         R       R-type thermocouple         S       S-type thermocouple         T       T-type thermocouple         S       S-type thermocouple         V       U-type thermocouple         T       T-type thermocouple         K       XK-type thermocouple         Z       1 mV/°C         Response: <none>         Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       XIEEE-488 XRS-232 XSequential Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:       <none></none></none>	Parameters:	<value></value>	
C       C-type thermocouple         E       E-type thermocouple         J       J-type thermocouple         K       K-type thermocouple         L       L-type thermocouple         R       R-type thermocouple         R       R-type thermocouple         S       S-type thermocouple         T       T-type thermocouple         S       S-type thermocouple         T       T-type thermocouple         XK       XK-type thermocouple         U       U-type thermocouple         XK       XK-type thermocouple         Z       1 mV/°C         Response: <none>         Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       XIEEE-488       RS-232       Sequential       Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.       Parameter:       <none></none></none>		where <value></value>	is one of the following:
E       E-type thermocouple         J       J-type thermocouple         K       K-type thermocouple         L       L-type thermocouple         N       N-type thermocouple         R       R-type thermocouple         S       S-type thermocouple         T       T-type thermocouple         U       U-type thermocouple         V       U-type thermocouple         K       XK-type thermocouple         Z       1 mV/°C         Response: <none>         Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       XIEEE-488         XRS-232       Sequential         Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:       <none></none></none>		В	B-type thermocouple
J       J-type thermocouple         K       K-type thermocouple         L       L-type thermocouple         N       N-type thermocouple         R       R-type thermocouple         S       S-type thermocouple         T       T-type thermocouple         U       U-type thermocouple         XK       XK-type thermocouple         Z       1 mV/°C         Response: <none>         Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       IEEE-488 IRS-232 Isequential Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:       <none></none></none>			
K       K-type thermocouple         L       L-type thermocouple         N       N-type thermocouple         R       R-type thermocouple         S       S-type thermocouple         T       T-type thermocouple         U       U-type thermocouple         XK       XK-type thermocouple         Z       1 mV/°C         Response: <none>         Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       XI IEEE-488 XRS-232 X Sequential Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:       <none></none></none>			
L       L-type thermocouple         N       N-type thermocouple         R       R-type thermocouple         S       S-type thermocouple         T       T-type thermocouple         U       U-type thermocouple         KK       XK-type thermocouple         BP       BP-type thermocouple         Z       1 mV/°C         Response: <none>         Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       X IEEE-488         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:       <none></none></none>			
N       N-type thermocouple         R       R-type thermocouple         S       S-type thermocouple         T       T-type thermocouple         U       U-type thermocouple         UK       XK-type thermocouple         Z       1 mV/°C         Response: <none>         Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       X IEEE-488         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:       <none></none></none>			<i>·</i> ·· ·
R       R-type thermocouple         S       S-type thermocouple         T       T-type thermocouple         U       U-type thermocouple         XK       XK-type thermocouple         BP       BP-type thermocouple         Z       1 mV/°C         Response:          Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       IEEE-488         RS-232       Sequential         Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:          Alone>			
S       S-type thermocouple         T       T-type thermocouple         U       U-type thermocouple         U       U-type thermocouple         BP       BP-type thermocouple         Z       1 mV/°C         Response: <none>         Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       X IEEE-488 X RS-232 X Sequential Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:       <none></none></none>			
TT-type thermocouple UUU-type thermocouple XKKXK-type thermocouple BPBPBP-type thermocouple 			
U U-type thermocouple XK XK-type thermocouple BP BP-type thermocouple Z 1 mV/°C Response: <none> Example: TC_TYPE J This example sets the thermocouple type to J-type. TC_TYPE? XIEEE-488 XRS-232 Sequential Overlapped This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement. Parameter: <none></none></none>			
XK       XK-type thermocouple         BP       BP-type thermocouple         Z       1 mV/°C         Response: <none>         Example:       TC_TYPE J         This example sets the thermocouple type to J-type.         TC_TYPE?       XIEEE-488 XRS-232 X Sequential Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:       <none></none></none>			
Z       1 mV/°C         Response: <none>         Example:       TC_TYPE J This example sets the thermocouple type to J-type.         TC_TYPE?       X IEEE-488       RS-232       X Sequential         Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter:       <none></none></none>		XK	
Response: <none>         Example:       TC_TYPE J This example sets the thermocouple type to J-type.         TC_TYPE?       X IEEE-488       RS-232       X Sequential       Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.       Parameter:       <none></none></none>		BP	· · · ·
Example:       TC_TYPE J This example sets the thermocouple type to J-type.         TC_TYPE?       IEEE-488 IRS-232 IS Sequential Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter: <none></none>		Z	1 mV/°C
This example sets the thermocouple type to J-type.         TC_TYPE?       IEEE-488       RS-232       Sequential       Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.       Parameter: <none></none>	Response:	<none></none>	
TC_TYPE?       X IEEE-488       X RS-232       X Sequential       Overlapped         This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement.         Parameter: <none></none>	Example:	TC_TYPE J	
This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement. Parameter: <pre></pre>		This example s	ets the thermocouple type to J-type.
This command returns the Thermocouple (TC) sensor type being used for TC temperature source and measurement. Parameter: <pre></pre>	TC_TYPE?		E-488 XRS-232 X Sequential Overlapped
		urns the Thermo	
	anumeasuremen		
Response:			
where <value> is one of the following:</value>	Parameter:	<none></none>	
B B-type thermocouple		<none> <value></value></none>	is one of the following:
	Parameter:	<none> <value> where <value></value></value></none>	-
E E-type thermocouple	Parameter:	<none> <value> where <value> B</value></value></none>	B-type thermocouple
J J-type thermocouple	Parameter:	<none> <value> where <value> B C</value></value></none>	B-type thermocouple C-type thermocouple
	Parameter:	<none> <value> where <value> B C E J</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple
	Parameter:	<none> <value> where <value> B C E J K</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple K-type thermocouple
	Parameter:	<none> <value> where <value> B C E J K L</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple K-type thermocouple L-type thermocouple
	Parameter:	<none> <value> where <value> B C E J K L N</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple K-type thermocouple L-type thermocouple N-type thermocouple
	Parameter:	<none> <value> where <value> B C E J K L N R</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple L-type thermocouple N-type thermocouple R-type thermocouple
	Parameter:	<none> <value> where <value> B C E J K L N R S</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple L-type thermocouple N-type thermocouple R-type thermocouple S-type thermocouple
	Parameter:	<none> <value> where <value> B C E J K L N R S T</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple L-type thermocouple N-type thermocouple R-type thermocouple S-type thermocouple T-type thermocouple
	Parameter:	<none> <value> where <value> B C E J K L N R S T U</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple K-type thermocouple N-type thermocouple R-type thermocouple S-type thermocouple T-type thermocouple U-type thermocouple
Z 1 mV/°C	Parameter:	<none> <value> where <value> B C E J K L N R S T U XK</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple L-type thermocouple N-type thermocouple R-type thermocouple S-type thermocouple T-type thermocouple
Example: TC_TYPE?	Parameter:	<none> <value> where <value> B C E J K L N R S T U XK BP</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple L-type thermocouple R-type thermocouple S-type thermocouple T-type thermocouple U-type thermocouple BP-type thermocouple
κ_	Parameter: Response:	<none> <value> where <value> B C E J K L N R S T U XK BP Z</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple L-type thermocouple R-type thermocouple S-type thermocouple T-type thermocouple U-type thermocouple BP-type thermocouple
This example indicates that the thermocouple sensor type is K-type.	Parameter: Response:	<none> <value> where <value> B C E J K L N R S T U XK BP Z TC_TYPE?</value></value></none>	B-type thermocouple C-type thermocouple E-type thermocouple J-type thermocouple L-type thermocouple R-type thermocouple S-type thermocouple T-type thermocouple U-type thermocouple BP-type thermocouple

TSENS_TYPE	XIEEE-488 XRS-232 Sequential Overlapped						
	s the temperature mode to thermocouple (TC) or Resistance Temperature Detector ture source and measurement.						
Parameters:	<value> where <value> is one of the following:</value></value>						
	TC Thermocouple RTD Resistance Temperature Detector						
Response:	<none></none>						
Example:	TSENS_TYPE RTD						
	This example sets the temperature mode to RTD.						
TSENS_TYPE?	IEEE-488 X RS-232 X Sequential Overlapped						
This command retu Detector (RTD).	urns the present temperature mode, thermocouple (TC) or Resistance Temperature						
Parameter:	<none></none>						
Response:	<value></value>						
	where <value> is one of the following:</value>						
	TC Thermocouple RTD Resistance Temperature Detector						
Example:	TSENS_TYPE?						
	TC						
	This example indicates that the present temperature mode is thermocouple.						
*TST?	XIEEE-488 XRS-232 Sequential Overlapped						
	is a series of self-tests and returns a "1" for pass or a "0" for fail. If any faults are logged into the fault queue where they can be read by the FAULT? query.						
Parameter:	<none></none>						
Response:	<value> where <value> is one of the following:</value></value>						
	<ul><li>0 failed self test</li><li>1 passed self test</li></ul>						
Example:	*TST?						
	1						
	This example runs the self test and indicates that it passed.						

VAL?	IEEE-488 XRS-232 Sequential Overlapped						
This command re	This command returns the last values for the isolated and primary measurements, in that order.						
Parameter:	<none></none>						
Response:	<iso-value>,<iso-units>,<primary-value>,<primary-units> where <iso-value> is the present isolated measurement expressed in scientific notation.</iso-value></primary-units></primary-value></iso-units></iso-value>						
	and where <iso-units> is one of the following:</iso-units>						
	<ul> <li>V DC volts</li> <li>A DC current</li> <li>OVER measurement is over or under range</li> <li>or one of the pressure units listed with the ISO_PRES_UNIT?</li> <li>command</li> </ul>						
	and where <primary-value> is the present primary measurement expressed in scientific notation.</primary-value>						
	and where <primary-units> is one of the following:</primary-units>						
	<ul> <li>FAR °F</li> <li>CEL °C</li> <li>OHM Ohms</li> <li>V DC volts (thermocouple millivolts)</li> <li>OVER measurement is over or under range</li> <li>NONE primary display is presently set to a source mode</li> </ul>						
	or one of the pressure units listed with the PRES_UNIT? command						
Example:	VAL?						
	2.137000E+00,V,5.763300E+01,CEL						
	This example indicates that the isolated measurement is 2.137 volts and that the primary measurement is 57.633 °C.						
*WAI	XIEEE-488 XRS-232 XSequential Overlapped						
commands have I CED 7000 to wait OUT with a *WAI	revents further remote commands from being executed until all previous remote been completed. For example, if you send an OUT command, you can cause the until the output has settled before continuing on to the next command if you follow command. The *WAI command is useful with any overlapped command, ED 7000 from processing other commands until the overlapped command is						
Parameter:	<none></none>						
Response:	<none></none>						
Example:	OUT 1.1 V						

\*WAI OPER FAULT? This example demonstrates setting the CED

This example demonstrates setting the CED 7000 output to 1.1 volts, waiting for the output to settle before activating the output and checking if the sequence of commands completed successfully.

ZERO_MEAS	XIEEE-488 XRS-232 XSequential Overlapped					
This command zeros a pressure module, the thermocouple mV offset, or the RTD ohms offset. For detailed zeroing instructions see section 4.3 for RTD ohms, section 4.7 for thermocouple millivolts, or section 4.9 for pressure.						
Parameter:	<none> for RTD ohms, thermocouple millivolts, or a pressure module that does not measure absolute pressure</none>					
	<value> is barometric pressure for absolute pressure modules, expressed in the currently selected pressure units</value>					
Response:	<none></none>					
Example:	ZERO_MEAS					
	If thermocouple millivolts are currently selected, this example zeros the offset.					
ZERO_MEAS?	XIEEE-488 XRS-232 XSequential Overlapped					
This command ret	turns the zero offset for pressure modules, thermocouple millivolts, or RTD ohms.					
Parameter:	<none></none>					
Response:	<zero offset="">,<units> where &lt; zero offset &gt; is the current offset.</units></zero>					
	and where <units> is one of the following:</units>					
	OHM Ohms V DC volts (thermocouple millivolts)					
	or one of the pressure units listed with the PRES_UNIT? command					
Example:	ZERO_MEAS?					
	1.060000E-01,PSI					
	This example indicates that the pressure zero for the attached module is 0.106 psi.					

# 11. Maintenance

### 11.1 Cleaning the Calibrator

# \land Warning

To avoid personal injury and/or damage to the Calibrator, use only the specified replacement parts and do not allow water into the case.

# \land Caution

To avoid damaging the case, do not use solvents or abrasive cleaners.

Clean the calibrator and pressure modules with a soft cloth dampened with water, or mild soap and water.

### 11.2 Replacing a Line Fuse

# \land Warning

To avoid electrical shock hazard disconnect line power before opening the case or fuse compartment.

The line power fuses and line voltage selector are located in the compartment above the power switch on the right rear of the Calibrator. See the rear panel layout in section 2.5.

Table 10 shows the correct replacement fuse for each line voltage setting.

#### Table 10 - Replacement Fuses

Fuse Description	Line Voltage Setting
0.25 A/250 V fast	120 V (90 V to 132 V)
0.125 A/250 V fast	240 V (198 V to 264 V)

To check or replace a fuse:

- 1. Disconnect the line power.
- 2. Using the blade of a suitable flat screwdriver, pry up the tab at the base of the line fuse compartment by inserting the blade in the center slot under the tab. The compartment cover will pop part way out.
- 3. Remove the compartment cover. The fuses come out with the compartment cover and can easily be checked or replaced.
- 4. To reinstall the fuse holder, push the compartment cover back into the compartment until the tab locks in place.

### 11.3 Changing the Line Voltage

The calibrator arrives from the factory configured for the line voltage appropriate for the country of purchase, or as specified when it is ordered. To verify the line voltage setting, check the line voltage indicator on the power line fuse compartment cover.

Confirm that the line voltage selection is set for 120 V for line voltages between 90 V and 132 V, or that the selector is set to 240 V for line voltages between 198 V and 264 V.



To avoid electrical shock hazard disconnect line power before opening the case or fuse compartment.

To change the line voltage:

- 1. Disconnect line power.
- 2. Using the blade of a suitable flat screwdriver, pry up the tab at the base of the line fuse compartment by inserting the blade in the center slot under the tab. The compartment cover will pop part way out.
- 3. Remove the compartment cover.
- 4. Remove the line voltage selector assembly by gripping the line voltage indicator tab with pliers and pulling it straight out of the compartment.
- 5. Rotate the line voltage selector assembly to the desired voltage and reinsert.
- 6. Verify you are using the appropriate fuse for the selected line voltage (see table 10 above), and reinstall the fuse compartment by pushing it in until the tab locks in place.

# 12. Specifications

# 12.1 General Specifications

Warm up time	Twice the tim	Twice the time since last warmed up, to a maximum of 30 minutes.				
Settling time	Less than 5	Less than 5 seconds for all functions and ranges except as noted.				
Standard interfaces	RS-232	RS-232				
	IEEE-488 (G	IEEE-488 (GPIB)				
Temperature performance	Operating	C	0 °C	C to 50 °C		
	Calibration (t	cal) 1	18 °	C to 28 °C		
	Storage	-	-20	°C to 70 °C		
EMC declaration	(controlled el 2006/95/EC,	2004/108/EC, EN 61326 emission (group 1, class B) and immunity (controlled electromagnetic environment) and 2006/95/EC, EN 61010-1 Safety for electrical equipment for measurement, control and laboratory use				
Temperature coefficient		Temperature coefficient for temperatures outside tcal $\pm 5$ °C is 10% of the 90 day specification (or 1 year if applicable) per °C				
Relative humidity	Operating	<	<80	% to 30 °C		
		<	<70	% to 40 °C		
		<	<40	% to 50 °C		
	Storage	<	<95	% noncondensing		
Altitude	Operating 3,	050 m (10,000 f	ft) n	naximum		
	Nonoperating	g 12,200 m (40,	,000	) ft) maximum		
Safety	EN 61010 Se 1010.1-92, N		A-S	82.01-1994,CAN/CSA-C22.2 No.		
Analog low isolation	20 V					
Line power	Line Voltage	(selectable)		100V/120V or 220V/240V		
	Line Frequer	псу		47 to 63 Hz		
	Line Voltage Variation ±10 % about setting			±10 % about setting		
Power consumption	15 VA maxin	num				
Dimensions	Height	13.3 cm (5.25	5 in)	plus 2.9 cm (1.15 in) for extended feet		
	Width standard rack width (19 inch)			dth (19 inch)		
	Depth 30.0 cm (11.81 in) overall					
Weight (without options)	4 kg (9 lb)					

# 12.2 DC Voltage Specifications, Output

		Absolute Uncertainty, tcal ±5 °C ± (ppm of output +μV)		Stability			
Ranges <sup>1</sup>	9	0 days		1 year	24 hours, ±1 °C ± (ppm of output +µV)	Resolution	Maximum Burden <sup>2</sup>
0 to 100.000 mV	25	3	30	3	5 ppm +2	1 mV	10 mA
0 to 1.00000 V	25	10	30	10	4 ppm + 10	10 µV	10 mA
0 to 10.0000 V	25	100	30	100	4 ppm + 100	100 µV	10 mA
0 to 100.000 V	25	1 mV	30	1 mV	5 ppm + 1 mV	1 mV	1 mA
TC Output and Inp	ut						
-10 to 75.000 mV	25	3 µV	30	3 µV	5 ppm + 2 µV	1 µV	10 Ω
1. All outputs are po 2. Remote sensing		•	utput re	sistance is ·	< 1W		

## 12.3 DC Voltage Specifications, Isolated Input

Ranges	Absolut tcal ±5 °C, ± (p	Resolution	
0 to 10.0000 V	50	0.2	100 μV
0 to 100.000 V	50	2.0	1 mV

## 12.4 DC Current Specifications, Output

	Absolute Uncertainty, tcal ±5 °C, ± (ppm of output + μA)				Maximum Compliance	Maximum Inductive	
Ranges <sup>1</sup>	90 day	/S	1 yea	r	Resolution	Voltage	Load
0 to 100.000 mA	40	1	50	1	1 µA	12 V	100 mH
1. All outputs are positive only.							

## 12.5 DC Current Specifications, Isolated Input

Ranges	Absolute Uncertainty, tcal ±5 °C, ± (ppm of reading +	Resolution						
0 to 50.0000 mA	100	1	0.1 µA					
1. Loop power: 24V ±1	1. Loop power: 24V ±10%							
2. HART resistor: 250W ±3%								
3. Maximum rated loop	o current: 24mA							

## 12.6 Resistance Specifications, Output

	Absolute Uncertainty, tcal ±5 °C, ± ohms						
Ranges <sup>1</sup>	90 days	1 year	Resolution	Nominal Current <sup>2</sup>			
5 to 400.000 Ω	0.012	0.015	0.001 Ω	1 to 3 mA			
5 to 4.00000 kΩ	0.25	0.3	0.01 Ω	100 µA to 1 mA			
1. Continuously vari	able from 0 to 4 kW.						
2. For currents lowe	2. For currents lower than shown, the specification becomes:						
	New Spec. = Stated Spec. x Imin / lactual.						
For example, a 500 μA stimulus measuring 100 W has a specification of:							
	0.015 W x 1 mA / 500 µA	= 0.03 W.					

### 12.7 Resistance Specifications, Input

	Absolute Un tcal ±5 °C ± (ppm			
Ranges	90 days	1 year	Resolution	Stimulus Current
5 to 400.000 Ω	20 + 0.0035	20 + 0.004	0.001 Ω	1 mA
5 to 4.00000 kΩ	20 + 0.035	20 + 0.04	0.01 Ω	0.1 mA

			Absolute U tcal ±5 °		
	Range (° C)		Outpu	t/Input	
ТС Туре	Minimum	Maximum	90 days	1 year	
	00 °C	800 °C	0.42 °C	0.46 °C	
В	0° 008	1000 °C	0.39 °C	0.39 °C	
В	1000 °C	1550 °C	0.40 °C	0.40 °C	
	1550 °C	1820 °C	0.44 °C	0.45 °C	
	0 °C	150 °C	0.25 °C	0.30 °C	
	150 °C	650 °C	0.21 °C	0.26 °C	
С	650 °C	1000 °C	0.23 °C	0.31 °C	
	1000 °C	1800 °C	0.38 °C	0.50 °C	
	1800 °C	2316 °C	0.63 °C	0.84 °C	
	-250 °C	-100 °C	0.38 °C	0.50 °C	
	-100 °C	-25 °C	0.16 °C	0.18 °C	
Е	-25 °C	350 °C	0.14 °C	0.15 °C	
	350 °C	650 °C	0.14 °C	0.16 °C	
	650 °C	1000 °C	0.16 °C	0.21 °C	
	-210 °C	-100 °C	0.20 °C	0.27 °C	
	-100 °C	-30 °C	0.18 °C	0.20 °C	
J	-30 °C	150 °C	0.14 °C	0.16 °C	
	150 °C	760 °C	0.14 °C	0.17 °C	
	760 °C	1200 °C	0.18 °C	0.23 °C	
	-200 °C	-100 °C	0.25 °C	0.33 °C	
	-100 °C	-25 °C	0.19 °C	0.22 °C	
К	-25 °C	120 °C	0.14 °C	0.16 °C	
	120 °C	1000 °C	0.19 °C	0.26 °C	
	1000 °C	1372 °C	0.30 °C	0.40 °C	
	-200 °C	-100 °C	0.37 °C	0.37 °C	
L	-100 °C	800 °C	0.26 °C	0.26 °C	
	800 °C	900 °C	0.17 °C	0.17 °C	
	-200 °C	-100 °C	0.33 °C	0.40 °C	
	-100 °C	-25 °C	0.20 °C	0.24 °C	
Ν	-25 °C	120 °C	0.16 °C	0.19 °C	
	120 °C	410 °C	0.14 °C	0.18 °C	
	410 °C	1300 °C	0.21 °C	0.27 °C	
1. Does not include the	rmocouple wire error.				

# 12.8 Thermocouple Specification, Output and Input

1. Does not include thermocouple wire error.

# Thermocouple Specification, Output and Input (continued)

			Absolute U tcal ±5 °C	C, ±(°C) <sup>1</sup>
	Range (° C)		Output	/Input
ТС Туре	Minimum	Maximum	90 days	1 year
	0°C	250 °C	0.58 °C	0.58 °C
Р	250 °C	400 °C	0.34 °C	0.35 °C
R	400 °C	1000 °C	0.31 °C	0.33 °C
	1000 °C	1750 °C	0.30 °C	0.40 °C
	0 °C	250 °C	0.56 °C	0.56 °C
S	250 °C	1000 °C	0.36 °C	0.36 °C
	1000 °C	1400 °C	0.30 °C	0.37 °C
	1400 °C	1750 °C	0.35 °C	0.46 °C

	-250 °C	-150 °C	0.51 °C	0.63 °C	
-	-150 °C	0 °C	0.18 °C	0.24 °C	
I	0°C	120 °C	0.13 °C	0.16 °C	
	120 °C	400 °C	0.12 °C	0.14 °C	
U	-200 °C	0°C	0.56 °C	0.56 °C	
U	0°C	600 °C	0.27 °C	0.27 °C	
	-200 °C	-100 °C	0.22 °C	0.22 °C	
ХК	-100 °C	300 °C	0.12 °C	0.13 °C	
	300 °C	800 °C	0.19 °C	0.20 °C	
	0°C	200 °C	0.42 °C	0.42 °C	
	200 °C	600 °C	0.32 °C	0.32 °C	
BP	600 °C	800 °C	0.39 °C	0.40 °C	
BP	800 °C	1600 °C	0.45 °C	0.46 °C	
	1600 °C	2000 °C	0.57 °C	0.58 °C	
	2000 °C	2500 °C	0.67 °C	0.80 °C	
1. Does not include thermocouple wire error.					

# 12.9 RTD and Thermistor Specification, Output

			Absolute U tcal ±5 °(	
	Range (° C)		Output/Input	
RTD Type	Minimum	Maximum	90 days	1 year
	-200 °C	-80 °C	0.03 °C	0.04 °C
	-80 °C	0 °C	0.04 °C	0.05 °C
	0 °C	100 °C	0.04 °C	0.05 °C
Pt 385, 100 Ω	100 °C	300 °C	0.03 °C	0.04 °C
	300 °C	400 °C	0.04 °C	0.04 °C
	400 °C	630 °C	0.04 °C	0.05 °C
	630 °C	800 °C	0.04 °C	0.05 °C
	-200 °C	-80 °C	0.03 °C	0.04 °C
	-80 °C	0 °C	0.03 °C	0.04 °C
Dt 2026 100 0	0 °C	100 °C	0.03 °C	0.04 °C
Pt 3926, 100 Ω	100 °C	300 °C	0.03 °C	0.04 °C
	300 °C	400 °C	0.03 °C	0.04 °C
	400 °C	630 °C	0.04 °C	0.05 °C
	-200 °C	-190 °C	0.03 °C	0.03 °C
	-190 °C	-80 °C	0.03 °C	0.04 °C
	-80 °C	0 °C	0.03 °C	0.04 °C
	0 °C	100 °C	0.03 °C	0.04 °C
Pt 3916, 100 Ω	100 °C	260 °C	0.03 °C	0.04 °C
	260 °C	300 °C	0.03 °C	0.04 °C
	300 °C	400 °C	0.03 °C	0.04 °C
	400 °C	600 °C	0.04 °C	0.05 °C
	600 °C	630 °C	0.04 °C	0.05 °C
	-200 °C	-80 °C	0.31 °C	0.38 °C
	-80 °C	0 °C	0.32 °C	0.38 °C
	0 °C	100 °C	0.33 °C	0.39 °C
Dt 205, 200, 0	100 °C	260 °C	0.33 °C	0.39 °C
Pt 385, 200 Ω	260 °C	300 °C	0.36 °C	0.43 °C
	300 °C	400 °C	0.36 °C	0.43 °C
	400 °C	600 °C	0.42 °C	0.50 °C
	600 °C	630 °C	0.42 °C	0.50 °C

	-200 °C	-80 °C	0.13 °C	0.15 °C	
	-80 °C	0 °C	0.13 °C	0.15 °C	
	0 °C	100 °C	0.13 °C	0.16 °C	
Pt 385, 500 Ω	100 °C	260 °C	0.14 °C	0.17 °C	
F1 363, 300 12	260 °C	300 °C	0.14 °C	0.17 °C	
	300 °C	400 °C	0.15 °C	0.18 °C	
	400 °C	600 °C	0.16 °C	0.19 °C	
	600 °C	630 °C	0.16 °C	0.19 °C	
1. 2-wire output					

## **RTD and Thermistor Specification, Output (continued)**

			Absolute L tcal ±5 °	Incertainty, C, ±(°C) <sup>1</sup>
	Rang	<u>i</u> e (° C)	Output/Input	
RTD Type	Minimum	Maximum	90 days	1 year
	-200 °C	-80 °C	0.06 °C	0.07 °C
	-80 °C	0 °C	0.06 °C	0.08 °C
	0 °C	100 °C	0.07 °C	0.08 °C
Dt 385 1000 O	100 °C	260 °C	0.07 °C	0.08 °C
Pt 385, 1000 Ω	260 °C	300 °C	0.07 °C	0.09 °C
	300 °C	400 °C	0.07 °C	0.09 °C
	400 °C	600 °C	0.08 °C	0.09 °C
	600 °C	630 °C	0.08 °C	0.09 °C
	-80 °C	0°C	0.02 °C	0.02 °C
Ni 120, 120 Ω	0 °C	100 °C	0.02 °C	0.02 °C
	100 °C	260 °C	0.01 °C	0.02 °C
Cu 427, 10 Ω <sup>2</sup>	-100 °C	260 °C	0.30 °C	0.38 °C
YSI 400	15 °C	50 °C	0.005 °C	0.007 °C
1. 2-wire output 2. Based on MINCO	Application Aid No. 18	3.		

# 12.10 RTD and Thermistor Specification, Input

			Absolute U tcal ±5 °0	
	Rang	<u>ie (° C)</u>	Output/Input	
RTD Type	Minimum	Maximum	90 days	1 year
	-200 °C	-80 °C	0.011 °C	0.012 °C
	-80 °C	0 °C	0.018 °C	0.020 °C
	0 °C	100 °C	0.018 °C	0.020 °C
Pt 385, 100 Ω	100 °C	300 °C	0.027 °C	0.030 °C
	300 °C	400 °C	0.031 °C	0.035 °C
	400 °C	630 °C	0.042 °C	0.047 °C
	630 °C	800 °C	0.050 °C	0.057 °C
	-200 °C	-80 °C	0.011 °C	0.011 °C
	-80 °C	0 °C	0.014 °C	0.015 °C
Pt 3926, 100 Ω	0 °C	100 °C	0.018 °C	0.019 °C
	100 °C	300 °C	0.026 °C	0.029 °C
	300 °C	400 °C	0.031 °C	0.034 °C
	400 °C	630 °C	0.041 °C	0.046 °C

-200 °C         -190 °C         0.006 °C         0.006 °C           -190 °C         -80 °C         0.011 °C         0.012 °C           -80 °C         0 °C         0.014 °C         0.015 °C           0 °C         100 °C         260 °C         0.025 °C         0.028 °C           260 °C         300 °C         0.026 °C         0.029 °C         0.034 °C           260 °C         300 °C         0.040 °C         0.031 °C         0.034 °C           400 °C         600 °C         0.040 °C         0.047 °C           600 °C         630 °C         0.042 °C         0.047 °C           -200 °C         -80 °C         0.012 °C         0.013 °C           9°C         100 °C         630 °C         0.042 °C         0.047 °C           -200 °C         -80 °C         0.008 °C         0.009 °C           -80 °C         0 °C         0.012 °C         0.013 °C           -80 °C         0 °C         0.015 °C         0.017 °C           -80 °C         0 °C         0.020 °C         0.022 °C           -80 °C         300 °C         0.050 °C         0.053 °C           -80 °C         300 °C         0.050 °C         0.053 °C           260 °C         30					
-80 °C         0 °C         0.014 °C         0.015 °C           0 °C         100 °C         0.018 °C         0.019 °C           100 °C         260 °C         0.025 °C         0.028 °C           260 °C         300 °C         0.031 °C         0.034 °C           300 °C         400 °C         0.040 °C         0.045 °C           400 °C         600 °C         0.040 °C         0.045 °C           600 °C         630 °C         0.040 °C         0.047 °C           600 °C         630 °C         0.012 °C         0.013 °C           600 °C         630 °C         0.040 °C         0.047 °C           600 °C         630 °C         0.012 °C         0.013 °C           600 °C         100 °C         0.015 °C         0.017 °C           100 °C         260 °C         0.020 °C         0.022 °C           100 °C         260 °C         0.020 °C         0.022 °C           260 °C         300 °C         0.053 °C         0.053 °C           300 °C         400 °C         0.053 °C         0.057 °C           400 °C         600 °C         0.070 °C         0.075 °C		-200 °C	-190 °C	0.006 °C	0.006 °C
Pt 3916, 100 Ω         0 °C         100 °C         0.018 °C         0.019 °C           Pt 3916, 100 Ω         100 °C         260 °C         0.025 °C         0.028 °C           260 °C         300 °C         0.026 °C         0.029 °C           300 °C         400 °C         0.031 °C         0.034 °C           400 °C         600 °C         0.040 °C         0.047 °C           600 °C         630 °C         0.012 °C         0.013 °C           -200 °C         -80 °C         0.008 °C         0.009 °C           -80 °C         0 °C         0.012 °C         0.013 °C           -80 °C         0 °C         0.012 °C         0.013 °C           -80 °C         0 °C         0.012 °C         0.013 °C           -80 °C         0 °C         0.015 °C         0.017 °C           -80 °C         300 °C         0.020 °C         0.022 °C           -80 °C         300 °C         0.050 °C         0.053 °C           100 °C         260 °C         300 °C         0.053 °C         0.057 °C           260 °C         300 °C         0.053 °C         0.057 °C         0.057 °C           400 °C         600 °C         0.070 °C         0.075 °C         0.075 °C		-190 °C	-80 °C	0.011 °C	0.012 °C
Pt 3916, 100 Ω         100 °C         260 °C         0.025 °C         0.028 °C           260 °C         300 °C         0.026 °C         0.029 °C           300 °C         400 °C         0.031 °C         0.034 °C           400 °C         600 °C         0.040 °C         0.045 °C           600 °C         630 °C         0.040 °C         0.047 °C           -200 °C         -80 °C         0.008 °C         0.009 °C           -80 °C         0 °C         0.012 °C         0.013 °C           -80 °C         0 °C         0.012 °C         0.013 °C           -80 °C         0 °C         0.015 °C         0.017 °C           -80 °C         0 °C         0.020 °C         0.027 °C           -80 °C         0 °C         0.015 °C         0.017 °C           -80 °C         300 °C         0.050 °C         0.053 °C           -80 °C         300 °C         0.050 °C         0.053 °C           -80 °C         300 °C         0.053 °C         0.057 °C           -80 °C         300 °C         0.053 °C         0.057 °C           -80 °C         300 °C         0.053 °C         0.057 °C           -80 °C         600 °C         0.070 °C         0.075 °C <td></td> <td>-80 °C</td> <td>0 °C</td> <td>0.014 °C</td> <td>0.015 °C</td>		-80 °C	0 °C	0.014 °C	0.015 °C
260 °C         300 °C         0.026 °C         0.029 °C           300 °C         400 °C         0.031 °C         0.034 °C           400 °C         600 °C         0.040 °C         0.045 °C           600 °C         630 °C         0.042 °C         0.047 °C           -200 °C         -80 °C         0.008 °C         0.009 °C           -80 °C         0 °C         0.012 °C         0.013 °C           -80 °C         0 °C         0.012 °C         0.013 °C           -80 °C         0 °C         0.012 °C         0.013 °C           -80 °C         0 °C         0.015 °C         0.017 °C           260 °C         300 °C         0.050 °C         0.053 °C           100 °C         260 °C         0.050 °C         0.053 °C           260 °C         300 °C         0.053 °C         0.057 °C           300 °C         400 °C         0.070 °C         0.075 °C		0°C	100 °C	0.018 °C	0.019 °C
300 °C         400 °C         0.031 °C         0.034 °C           400 °C         600 °C         0.040 °C         0.045 °C           600 °C         630 °C         0.042 °C         0.047 °C           -200 °C         -80 °C         0.008 °C         0.009 °C           -80 °C         0 °C         0.012 °C         0.013 °C           0 °C         100 °C         0.015 °C         0.017 °C           100 °C         260 °C         0.020 °C         0.022 °C           260 °C         300 °C         0.053 °C         0.053 °C           300 °C         400 °C         0.053 °C         0.057 °C           400 °C         600 °C         0.070 °C         0.075 °C	Pt 3916, 100 Ω	100 °C	260 °C	0.025 °C	0.028 °C
400 °C         600 °C         0.040 °C         0.045 °C           600 °C         630 °C         0.042 °C         0.047 °C           -200 °C         -80 °C         0.008 °C         0.009 °C           -80 °C         0 °C         0.012 °C         0.013 °C           0 °C         100 °C         0.020 °C         0.022 °C           260 °C         300 °C         0.050 °C         0.053 °C           260 °C         300 °C         0.053 °C         0.057 °C           400 °C         600 °C         0.070 °C         0.075 °C		260 °C	300 °C	0.026 °C	0.029 °C
600 °C         630 °C         0.042 °C         0.047 °C           -200 °C         -80 °C         0.008 °C         0.009 °C           -80 °C         0 °C         0.012 °C         0.013 °C           0 °C         100 °C         0.015 °C         0.017 °C           100 °C         260 °C         0.020 °C         0.022 °C           260 °C         300 °C         0.053 °C         0.053 °C           300 °C         400 °C         0.053 °C         0.057 °C		300 °C	400 °C	0.031 °C	0.034 °C
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$		400 °C	600 °C	0.040 °C	0.045 °C
-80 °C         0 °C         0.012 °C         0.013 °C           0 °C         100 °C         0.015 °C         0.017 °C           100 °C         260 °C         0.020 °C         0.022 °C           260 °C         300 °C         0.053 °C         0.053 °C           300 °C         400 °C         0.075 °C         0.075 °C		600 °C	630 °C	0.042 °C	0.047 °C
θ         0 °C         100 °C         0.015 °C         0.017 °C           Pt 385, 200 Ω         100 °C         260 °C         0.020 °C         0.022 °C           260 °C         300 °C         0.050 °C         0.053 °C           300 °C         400 °C         0.053 °C         0.057 °C           400 °C         600 °C         0.070 °C         0.075 °C		-200 °C	-80 °C	0.008 °C	0.009 °C
Pt 385, 200 Ω         100 °C         260 °C         0.020 °C         0.022 °C           260 °C         300 °C         0.050 °C         0.053 °C           300 °C         400 °C         0.053 °C         0.057 °C           400 °C         600 °C         0.070 °C         0.075 °C		-80 °C	0 °C	0.012 °C	0.013 °C
Pt 385, 200 Ω         260 °C         300 °C         0.050 °C         0.053 °C           300 °C         400 °C         0.053 °C         0.057 °C           400 °C         600 °C         0.070 °C         0.075 °C	Pt 385, 200 Ω	0°C	100 °C	0.015 °C	0.017 °C
260 °C         300 °C         0.050 °C         0.053 °C           300 °C         400 °C         0.053 °C         0.057 °C           400 °C         600 °C         0.070 °C         0.075 °C		100 °C	260 °C	0.020 °C	0.022 °C
400 °C 600 °C 0.070 °C 0.075 °C		260 °C	300 °C	0.050 °C	0.053 °C
		300 °C	400 °C	0.053 °C	0.057 °C
600 °C 630 °C 0.071 °C 0.076 °C		400 °C	600 °C	0.070 °C	0.075 °C
		600 °C	630 °C	0.071 °C	0.076 °C
-200 °C -80 °C 0.007 °C 0.008 °C		-200 °C	-80 °C	0.007 °C	0.008 °C
-80 °C 0 °C 0.019 °C 0.020 °C		-80 °C	0 °C	0.019 °C	0.020 °C
0 °C 100 °C 0.023 °C 0.025 °C		0°C	100 °C	0.023 °C	0.025 °C
Pt 385, 500 Ω 100 °C 260 °C 0.030 °C 0.033 °C	Pt 385 500 O	100 °C	260 °C	0.030 °C	0.033 °C
260 °C 300 °C 0.032 °C 0.035 °C	Ρτ 385, 500 Ω	260 °C	300 °C	0.032 °C	0.035 °C
300 °C 400 °C 0.037 °C 0.041 °C		300 °C	400 °C	0.037 °C	0.041 °C
400 °C 600 °C 0.047 °C 0.052 °C		400 °C	600 °C	0.047 °C	0.052 °C
600 °C 630 °C 0.048 °C 0.053 °C		600 °C	630 °C	0.048 °C	0.053 °C
1. 4-wire mode. Uncertainties listed do not include probe uncertainties.	1. 4-wire mode. Uncer	tainties listed do not incl	lude probe uncertainties		

# **RTD** and Thermistor Specification, Input (continued)

			Absolute U tcal ±5 °C					
	Rang	e (° C)	Output	/Input				
RTD Type	Minimum	Maximum	90 days	1 year				
	-200 °C	-80 °C	0.011 °C	0.012 °C				
	-80 °C	0 °C	0.014 °C	0.015 °C				
	0 °C	100 °C	0.019 °C	0.020 °C				
	100 °C	260 °C	0.025 °C	0.028 °C				
	260 °C	300 °C	0.027 °C	0.030 °C				
	300 °C	400 °C	0.030 °C	0.034 °C				
	400 °C	600 °C	0.041 °C	0.045 °C				
Pt 385, 1000 Ω	600 °C	630 °C	0.042 °C	0.047 °C				
	-80 °C	0 °C	0.009 °C	0.010 °C				
	0 °C	100 °C	0.010 °C	0.011 °C				
Νi 120, 120 Ω	100 °C	260 °C	0.011 °C	0.012 °C				
Cu 427, 10 Ω <sup>2</sup>	-100 °C	260 °C	0.067 °C	0.069 °C				
YSI 400	15 °C	50 °C	0.005 °C	0.007 °C				
SPRT	-200 °C	660 °C	0.05 °C	0.06 °C				
1. 4-wire mode. Uncer	tainties listed do not inc	lude probe uncertainties	3					
2. Based on MINCO	Application Aid No. 18	3.		2. Based on MINCO Application Aid No. 18.				

### 12.11 Pressure Measurement Specifications

The CED 7000 can accept either the Fluke Corporation 700 series pressure modules, Mensor Corporation 6100 series pressure modules, or Martel Electronics Corporation BETA Port-P pressure modules. Pressure modules plug directly into the front panel Lemo connector with the CED 7000 firmware autodetecting the type and value of the module you are attaching.

Range	Accuracy and Resolution	Units
Determined by the pressure module	Determined by the pressure module	PSI(pounds per square inch)
		in H <sub>2</sub> O 4 <sup>o</sup> C
		(inches of water at 4 degrees Celsius)
		in H <sub>2</sub> O 20°C
		(inches of water at 20 degrees Celsius)
		in H <sub>2</sub> O 60°F
		(inches of water at 60 degrees Fahrenheit)
		cm H <sub>2</sub> O 4 <sup>o</sup> C
		(centimeters of water at 4 degrees Celsius)
		cm H <sub>2</sub> O 20°C
		(centimeters of water at 20 degrees Celsius)
		mm H <sub>2</sub> O 4ºC
		(millimeters of water at 4 degrees Celsius)
		mm H <sub>2</sub> O 20°C
		(millimeters of water at 20 degrees Celsius)
		BAR
		(bars)
		mBAR
		(millibars)
		kPa
		(kilopascals)
		MPa
		(megapascals)
		in HG 0⁰C
		(inches of mercury at 0 degrees Celsius)
		mm HG 0°C
		(millimeters of mercury at 0 degrees Celsius)
		Kg/cm2
		(kilograms per square centimeter)

# 13. Warranty

WIKA warrants all products against material defects and workmanship for a period of twenty-four (24) months after the date of shipment. Problems or defects that arise from misuse or abuse of the instrument are not covered. If any product is to be returned, a "Return Material Authorization" number must be obtained from our Customer Service Department. This number must be indicated on the return package as notice to our Receiving Department to accept the shipment. Any package not so marked will not be accepted and will be returned to the shipper. WIKA will not be responsible for damage as a result of poor return packaging. Out of warranty repairs and recalibration will be subject to specific charges. Under no circumstances will WIKA be liable for any device or circumstance beyond the value of the product.

This ProcessCalibrator is maintenance-free.

Repairs must only be carried out by the manufacturer.



WIKA Alexander Wiegand SE & Co. KG Alexander-Wiegand-Straße 30 63911 Klingenberg - Deutschland Tel.: +49 9372 132-0 Fax: +49 9372 132-406 E-Mail: info@wika.de